



## MAS002928\_Remarks on Skyhook ECU (NCS) removal from PROXI on M139



DATE: February 3, 2022

The purpose of this Technical Information is to inform you about the drawback when attempting to remove the Skyhook ECU (NCS) on some Model Years of Quattroporte (M139). This consists in the impossibility to remove the Active Suspension Warning Light on Cluster on some Model Years (MY05 and MY06) of Quattroporte (M139 model).

**MODELS:** M139 Model Years MY05 and MY06 (both ends included) equipped with Active Suspensions (Skyhook)

**PROBLEM:** After applying the PROXI Change request 00021 - Remove Skyhook ECU for M139-M145 and performing:

1. NBC > PROXI Programming
2. NBC > PROXI Alignment

The NCS ECU is eliminated from the PROXI of the NBC as expected, nevertheless the Active Suspension Warning Light is lit on the Cluster and the error message "Check Suspensions" is shown on the Central Display of the Instrument Panel Cluster (NQS) as shown in Figure 1.



**Figure 1:** error message on the NQS display and Active Suspensions warning light.

This is due to the intrinsic architecture of the NQS Base software for the NQS of the Models described in the MODELS section and there is no possibility to change this behaviour.

As a result, the removal of the Skyhook ECU (NCS) is not feasible for MY05 and MY06 of M139.

If you have any questions, contact the Technical Support Helpdesk.