MAS002970 (MSC 22-02)

Campaign 468 FROM: Maserati TSO TO: Maserati Network



MASTERS OF CARE

Service Campaign 468 MC20 - DCTM Adaptive Parameter Writing



DATE: February 17, 2022

Maserati MC20 (M240)cars in the attached list are involved in a Service Campaign to update the DCTM adaptive parameters.

The update is needed to correct the values downloaded on a limited number of cars. to help prevent the erroneous lighting of the gearbox and/or poor performance warning lights in the instrument cluster.

If you have any questions, contact your Regional AfterSales Manager or the Technical Support Helpdesk.

© 2022 Maserati Americas Aftersales www.maseratiusa.com All rights reserved. Reproduction or translation in whole or in part is not permitted without authorization from the publisher. Printed in USA.

Operational Procedure 1

- 1. Check in ModisCS+ to see if the car is involved in this campaign and whether the campaign has not been previously performed.
- 2. Make sure that the engine is off.
- 3. With MD EVO, run the command DCTM => Replace Gearbox

This procedure is only needed to write the new serial number. The gearbox does not have to be replaced.

4. During the procedure, the MD EVO will display the following prompt:

"Frame the Data Matrix code of the gearbox, using the MD EVO camera or press Manual Input to enter the gearbox serial number manually. The gearbox serial number is a 30-digit value to be entered without spaces or dashes" => Select Manual Input

5. Write down the serial number associated with the VIN, as shown in the attached VIN List.

Region	Market	Importe r Code	Importer Name	Market Assistance	Assistanc e Code	Dealer Assistance Name	Model	Complete VIN	VIN	Status	TRN
North America	U.S.A.	063680	Maserati North America	U.S.A.	006102	Valenti Maserati	MC20 MY22	ZAM24BXA1N0378726	378726	95	TR1126604030670154772051180300
North America	Canada	070133	Maserati Canada Inc.	Canada	006417	Maserati Of Ontario	MC20 MY22	ZAM24BXA1N0385188	385188	90	TR1129105190670154772047720100
North America	U.S.A.	063680	Maserati North America	U.S.A.	006860	Maserati Of Palm Beach	MC20 MY22	ZAM24BXA2N0378721	378721	95	To be checked from the Gearbox
North America	U.S.A.	063680	Maserati North America	U.S.A.	006280	Maserati Of Greenwich	MC20 MY22	ZAM24BXA2N0379786	379786	91	TR1122703770670154772047720100

- 6. If the chassis number is marked as "To be checked from the Gearbox", the serial number must be read directly from the plate on the gearbox, following the procedure shown below.
- 7. Confirm.
- 8. The procedure is complete.

NOTE: If an error occurs during the procedure, open a BOL report with a support request.



Operational Procedure 2 - Reading the serial number from the plate on the gearbox.

1. Check whether the car is involved and is marked as "To be checked from gearbox".

Region	Market	Importe r Code	Importer Name	Market Assistance	Dealer Assistanc e Code	Dealer Assistance Name	Model	Complete VIN	VIN	Status	TRN
North America	U.S.A.	063680	Maserati North America	U.S.A.	006102	Valenti Maserati	MC20 MY22	ZAM24BXA1N0378726	378726	95	TR112660403067015477205
North America	Canada	070133	Maserati Canada Inc.	Canada	006417	Maserati Of Ontario	MC20 MY22	ZAM24BXA1N0385188	385188	90	TR112910519067015477204
North America	U.S.A.	063680	Maserati North America	U.S.A.	006860	Maserati Of Palm Beach	MC20 MY22	ZAM24BXA2N0378721	378721	95	To be checked from the G
Month Amorica	11.5.4	062690	Macarati North Amorica	11.5.4	006390	Macarati Of Creanwish	MC20 MV22	7444240240270705	270706	01	TD110070077067016477004

2. The gearbox plate is positioned as shown in the following image



- 3. Remove the heat guard following the procedure: 9.63.106.0 COLD END HEAT COVER
- 4. Take note of the serial number on the plate. Follow the procedures from steps 1-8 for entry with MD EVO



NOTE: The serial number can also be read by activating the MD EVO internal camera, framing the QR code and selecting the "SCAN" function.

Manuras Diagrani (VO Paterto Selector Acceptation Vehicle View Pott Providence	ven af nearge	💻 _ X
Procedures		
Insert code		
General		Activities
TR1126603950670154772047720100		
Synoppic		Service
Ok Scan Manual entry	Abort	
En Constanting		

Warranty Claim

Complete the warranty claim as follows:

Description	Code
Campaign Number	468
Warranty Code	23
Fault Code	063
Component Code	3.10.147
Operation Code	
Procedure 1	3.10.147.C (0.15h)
Procedure 2	3.10.147.D (1.65h)

Market	Dealer Code	Model	Complete VIN	VIN	TRN
U.S.A.	006860	MC20 MY22	ZAM24BXA2N0378721	378721	To be checked from the Gearbox
U.S.A.	006102	MC20 MY22	ZAM24BXA1N0378726	378726	TR1126604030670154772051180300
U.S.A.	006501	MC20 MY22	ZAM24BXA9N0379784	379784	TR1118906050670154772047720100
U.S.A.	006280	MC20 MY22	ZAM24BXA2N0379786	379786	TR1122703770670154772047720100
U.S.A.	006125	MC20 MY22	ZAM24BXA8N0379792	379792	TR1122704350670154772047720100
U.S.A.	006087	MC20 MY22	ZAM24BXA2N0379822	379822	TR1126605280670154772047720100
U.S.A.	006064	MC20 MY22	ZAM24BXA6N0379824	379824	TR1126605850670154772047720100
U.S.A.	006076	MC20 MY22	ZAM24BXA4N0380728	380728	TR1122703930670154772047720100
U.S.A.	006087	MC20 MY22	ZAM24BXA8N0380747	380747	TR1116805680670154772047720100
Canada	006417	MC20 MY22	ZAM24BXA1N0385188	385188	TR1129105190670154772047720100