

JLRTB02100NAS1

TECHNICAL BULLETIN

16 MAY 2022



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

SECTION:

501-16

SUBJECT/CONCERN:

Rear Window and Rear Proximity Camera Wash Not Operating

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Range Rover (LK)	2022	000255-001600	Solihull

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

The washing system for the rear window and/or the rear proximity camera may not operate and washer fluid may also be found under the vehicle.

CAUSE:

The rear washer intermediate connector becomes adrift.

ACTION:

Follow the instruction(s) below.

PARTS:

NOTE:

An allowance equivalent to \$1.00 has been allocated to locally source 4 100mm x 2.5mm black cable ties.

PART NUMBER	DESCRIPTION	QUANTITY
ZZZ001	4 black cable ties - 100mm x 2.5mm	\$1.00

WARRANTY:

NOTE:

* When submitting your Warranty claim within the Warranty portal, use the Condition Code list shown to select the Condition Code which best describes the vehicle defect.

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.
- The JLR claims submission system requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
JLRTB - Rear Washer hose - Modification	99.01.73	0.5	*	LR159584


NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION - LEFT HAND DRIVE VEHICLES:

1. Remove the cowl panel grille for access only (see TOPIx Workshop Manual section 501-02: Front End Body Panels - Removal and Installation - Cowl Panel Grille).

2.

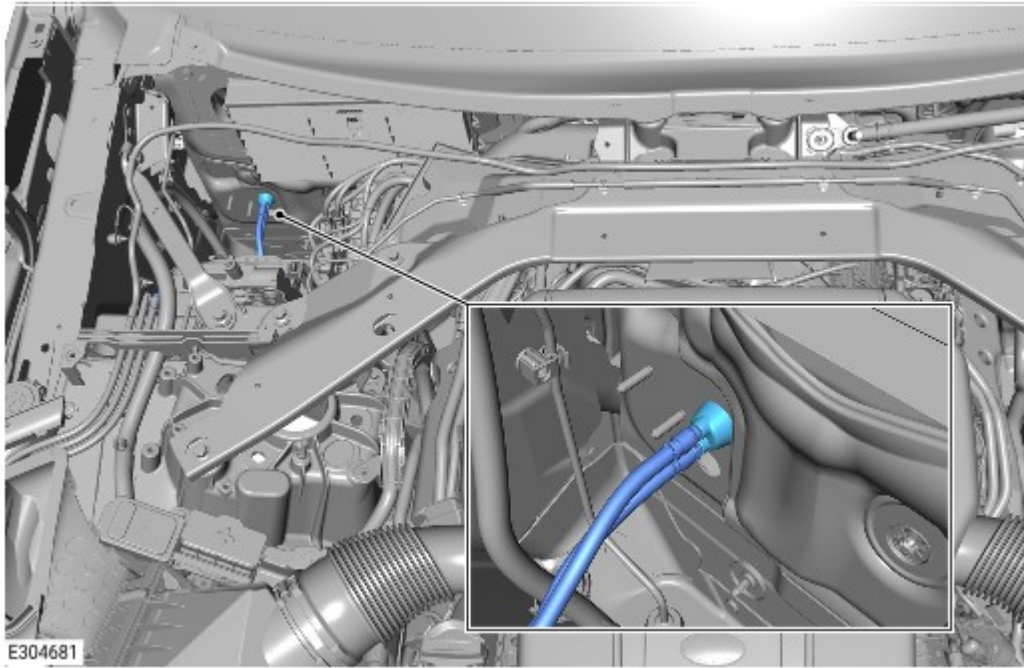


This image shows the location of the rear washer intermediate connector grommet.

3.

NOTE:

Make sure both rear washer hoses are fully installed in the intermediate connector grommet.

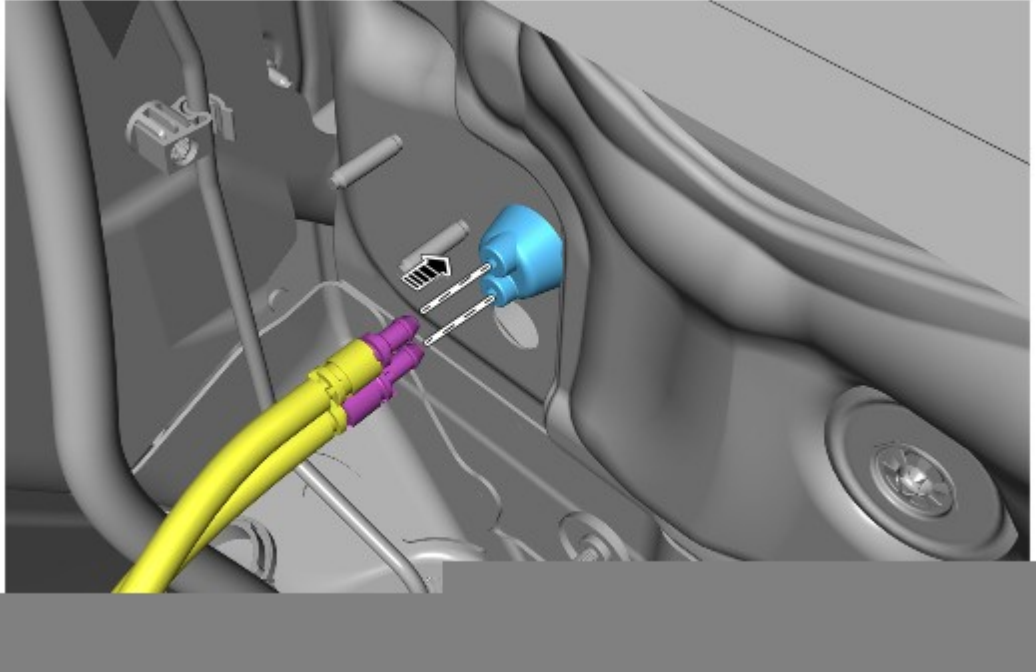

If 1 or both of the rear washer hoses are uninstalled from the intermediate connector grommet, reinstall the hose(s) in the correct location.

4.

NOTE:

The cable ties must be installed in the positions shown in the image.



To secure the rear wash hoses, install 1 cable tie around each intermediate connector inlet on the grommet, as shown in the image.

- Use a suitable tool to remove the excess from the cable ties.

5. Test the operation of the rear window wash.

- If the rear window wash switch operated rear window wash as expected, **continue to step 7.**
 - If the rear window wash switch operated the rear proximity camera wash instead of the rear window wash, **the rear washer hoses have been installed in the incorrect locations, continue to step 6.**
-

6. The rear washer hoses must be removed and installed in the correct locations.

- Remove both cable ties.

- **NOTE:**

Note the location of the rear washer hoses before removal.

Remove both rear washer hoses intermediate connector grommet.

- Install the rear washer hoses in the opposite locations to which they were previously installed.
- Repeat step 4.

-
7. Install the cowl panel grille (see TOPIx Workshop Manual section 501-02: Front End Body Panels - Removal and Installation - Cowl Panel Grille).