

Limited PCM Function due to Excess Temperature: Checking Installation Position of PCM Central Computer (46/22)

Model Line: **911 (992)**

Model Year: **As of 2021 up to 2022**

Concerns: **Holder for PCM central computer**

Information: There is a possibility that holders for the PCM central computer that were installed during series production are not suitable for the respective type of computer. If the combination of PCM central computer and holder is incorrect, the fan of the PCM central computer is covered by the holder. This can cause the PCM central computer to overheat.

Action required: In the event of a complaint, check whether the fan of the PCM central computer is covered by the holder. If the fan is covered, replace the holder for the PCM central computer.

Parts required

Parts Info: **Required Parts Info:**

Part No.	Designation – Location	Number
N 91026201	⇒ Hexagon collar nut, M10 - Rear belt buckle	2 units
Additional parts required if the holder for the PCM central computer has to be replaced:		
992857114A	⇒ Support – PCM central computer (M-no. I8L)	1 unit
or		
992857114B	⇒ Support – PCM central computer (M-no. I8Z)	1 unit

Preparatory work

Work Procedure: 1 Remove knee cushion on the left-hand side of the vehicle.
For instructions, see: ⇒ *Workshop Manual '68171900 Removing and installing centre console (upper part)'*

Checking installation position of PCM central computer

Work Procedure: 1 Check whether the fan of the PCM central computer is covered by the holder ⇒ *Holder for PCM central computer*.



Information

Also, if necessary, replace the PCM central computer if defective.

- If the fan of the PCM central computer is free and is not covered by the holder ⇒ *Holder for PCM central computer*, continue with ⇒ *Technical Information '68171900 Concluding work'*. The complaint must be found in some other way and corrected.
- If the fan is covered by the holder ⇒ *Holder for PCM central computer*, replace the holder for the PCM central computer. For instructions, see: ⇒ *Workshop Manual '915219 Removing and installing central computer'*



Holder for PCM central computer

Concluding work

Work Procedure: 1 Install knee cushion on the left-hand side of the vehicle.
For instructions, see: ⇒ *Workshop Manual '68171900 Removing and installing centre console (upper part)'*

Invoicing

For documentation and invoicing in a guarantee case, state the work items required depending on the scope of work and the specified PCSS encryption in the warranty claim:

APOS	Labor operation	I No.
91520100	Checking central computer	
91521900	Removing and installing central computer	

PCSS encryption:

Location (FES5)	91520	Central computer
Damage type (SA4)	1211	wrong part

References: ⇒ *Workshop Manual '68171900 Removing and installing centre console (upper part)'*
⇒ *Workshop Manual '915219 Removing and installing central computer'*

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2022 Porsche Cars North America, Inc.