

**WNB2 – Replacing Skid Plate (Workshop Campaign)**

Vehicle Type: **Macan (95B) / Macan S (95B) / Macan GTS (95B)**

Model Year: **2022**

Equipment: Skid part in vehicle color, skid plate in black (M-no. 2JQ)

Concerns: **Skid plate**

Information: **Due to an allocation error in the parts list, a skid plate in body color or matt black was fitted to the affected vehicles instead of the ordered high-gloss black front skid plate.**

Action required: Replace skid plate.




**Information**

The front skid plates previously fitted to the vehicle must then be properly scrapped or disposed of. To do this, render the skid plate unusable with an angle grinder and attach appropriate photo documentation to the warranty claim.

Further use of the skid plate is prohibited.

Affected Vehicles: Only the vehicles assigned to the campaign (see also PCSS Vehicle Information).

Installation  
position:

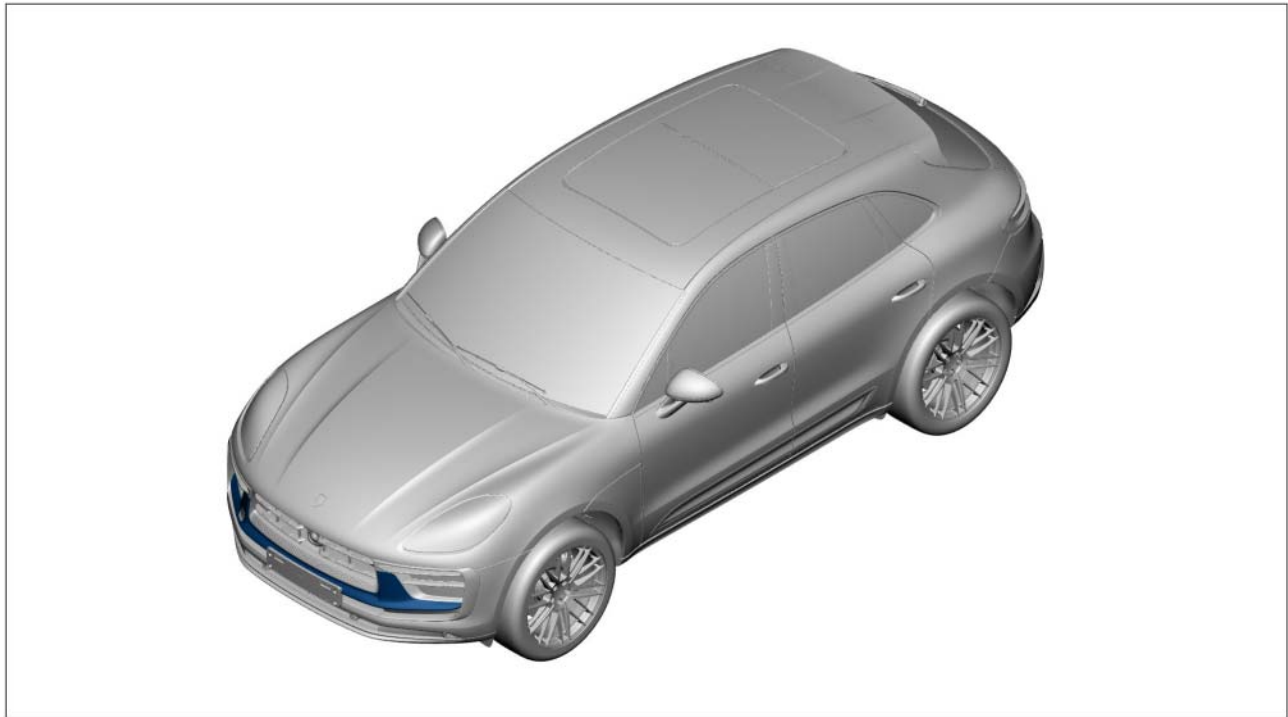

*Installation position of skid plate*

## Parts required

Parts Info:	Part No.	Designation	Number
	95B827555	⇒ Trim (grille, prime-coated)	1 ea.

Expendable items: Materials required for **painting** the skid plate:

- Painted in black high-gloss\*

\* For warranty processing, enter the **Part No. WNB20000001** with the designation "Expendable items" as an **additional part** in the warranty claim. These include all materials used for the entire area for the respective work item (including masking materials, sanding materials and cleaning agents as well as paint in black high-gloss color). For details, see ⇒ *Technical Information 'Warranty processing'*.

### Preparatory work

- Work Procedure: 1 Remove cover for front lock support. ⇒ *Workshop Manual '703919 Removing and installing cover for front lock support'*
- 2 Remove the front cover. ⇒ *Workshop Manual '700219 Removing and installing front trim'*
- 3 Remove the front apron. ⇒ *Workshop Manual '631519 Removing and installing front apron'*
- 4 Remove number plate cover.  
⇒ *Workshop Manual '668319 Removing and installing number plate cover'*  
**or**  
⇒ *Workshop Manual '668319 Removing and installing license plate cover (USA)'*

### Replacing skid plate

- Work Procedure: 1 Remove skid plate. ⇒ *Workshop Manual '631619 Removing and installing skid plate'*
- 2 Paint new skid plate in high-gloss black.



#### Information

#### Painting stage S1 - new part painting

The painting of new body parts - including sub-parts and sections - is referred to as "new part painting". A differentiation is made between screwed parts and welded parts.

The painting of visible and invisible interior surfaces, e.g. the lid hinge, is classified as Painting stage 1.

#### Stage 1 includes:

- Phase I - Preparation
- Phase II - Priming
- Phase III – Painting
- Phase IV - Applying clear lacquer

Information on painting can be found in the "Paint Manual - Painting method for plastic components".

- 3 Install skid plate. ⇒ *Workshop Manual '631619 Removing and installing skid plate'*

### Concluding work

- Work Procedure: 1 Install number plate cover.  
⇒ *Workshop Manual '668319 Removing and installing number plate cover'*  
**or**  
⇒ *Workshop Manual '668319 Removing and installing license plate cover (USA)'*

- 2 Installing front apron. ⇒ *Workshop Manual '631519 Removing and installing front apron'*
- 3 Installing front trim. ⇒ *Workshop Manual '700219 Removing and installing front trim'*
- 4 Install cover for front lock support. ⇒ *Workshop Manual '703919 Removing and installing cover for front lock support'*
- 5 For vehicles with 'Reversing camera incl. Surround View (M-no. KA6)' also calibrate the Surround View camera.  
For instructions, see: ⇒ *Workshop Manual '917225 Calibrating Surround View camera control unit'*
- 6 Enter the campaign in the Guarantee and Maintenance booklet.

### Warranty processing



#### Information

- Porsche dealers that carry out **this action in full** must invoice **Scope 1** or **Scope 2** in each case.
- Porsche dealers that hand over the nose panel to an **external service provider** to carry out the necessary **painting work** must invoice **Scope 3** or **Scope 4**. Please include a copy of the invoice for external services with the warranty claim.

Scope 1: The replacement of the nose panel was carried out **in full** by the **Porsche dealer**.

<b>Labor time:</b>		
Replacing skid plate		Labor time: <b>349 TU</b>
Includes:	Removing and installing skid plate Painting the bow with topcoat	
<b>Parts required:</b>		
95B827555	Trim (grille, prime-coated)	1 ea.
WNB20000001*	Expendable items	1 ea. (for warranty invoicing only)
* Enter the part number <b>WNB20000001</b> with the designation "Consumables" as an <b>additional part</b> in the warranty claim, amount max. \$ 37.50.		
⇒ <b>Damage code WNB2 066 000 2</b>		

Scope 2: The replacement of the nose panel was carried out **in full** by the **Porsche dealer**.

**Vehicles with equipment M-no. KA6**

**Labor time:**

Replacing skid plate Labor time: **411 TU**  
 Includes: Removing and installing skid plate  
 Painting the bow with topcoat  
 Calibrating Surround View camera

**Parts required:**

95B827555	Trim (grille, prime-coated)	1 ea.
WNB20000001*	Expendable items	1 ea. (for warranty invoicing only)

\* Enter the part number **WNB20000001** with the designation "Consumables" as an **additional part** in the warranty claim, amount max.\$ 37.50.

⇒ **Damage code WNB2 066 000 2**

Scope 3: The **painting** of the nose panel was carried out by an **external service provider**.

**Labor time:**

Replacing skid plate Labor time: **169 TU**  
 Includes: Removing and installing skid plate

**Parts required:**

95B827555	Trim (grille, prime-coated)	1 ea.
WNB20000001*	Expendable items	1 ea. (for warranty invoicing only)

**Sublet labor:**

Painting the bow with topcoat Sublet labor time: **max. 180 TUs\***

\* Enter the part number **WNB20000001** with the designation "Consumables" as an **additional part** in the warranty claim, amount max.\$ 37.50.

\*\* The maximum amount that will be paid as sublet labor time is the amount corresponding to the specified working time based on the individual charging rate under warranty of the respective Porsche dealer. Please include a copy of the invoice for external services with the warranty claim.

⇒ **Damage code WNB2 066 000 2**

Scope 4: The **painting** of the nose panel was carried out by an **external service provider**.

**Vehicles with equipment M-no. KA6**

**Labor time:**

Replacing skid plate

Labor time: **231 TU**

Includes: Removing and installing skid plate  
Calibrating Surround View camera

**Parts required:**

95B827555 Trim (grille, prime-coated)

1 ea.

WNB20000001\* Expendable items

1 ea.

(for warranty invoicing only)

**Sublet labor:**

Painting the bow with topcoat

Sublet labor time: **max.**

**180 TUs\***

\* Enter the part number **WNB20000001** with the designation "Consumables" as an **additional part** in the warranty claim, amount max. \$ 37.50.

\*\* The maximum amount that will be paid as sublet labor time is the amount corresponding to the specified working time based on the individual charging rate under warranty of the respective Porsche dealer. Please include a copy of the invoice for external services with the warranty claim.

⇒ **Damage code WNB2 066 000 2**

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2022 Porsche Cars North America, Inc.