

WMJ2 - Rework on Threaded Joint for Ground Point (Workshop Campaign)

Model Line: **911 (992)**

Model Year: **As of 2020 up to 2022**

Concerns: **Threaded joint securing ground point to body**


Information: **There is a possibility that the threaded joint for the ground point on the body does not comply with specifications on the affected vehicles.**

If this is the case, the power of the starter may be reduced in the worst case situation.

Action required: Rework on threaded joint for ground point on the body.

Affected Vehicles: Only vehicles assigned to the campaign (see also PCSS Vehicle Information).

Installation Position:

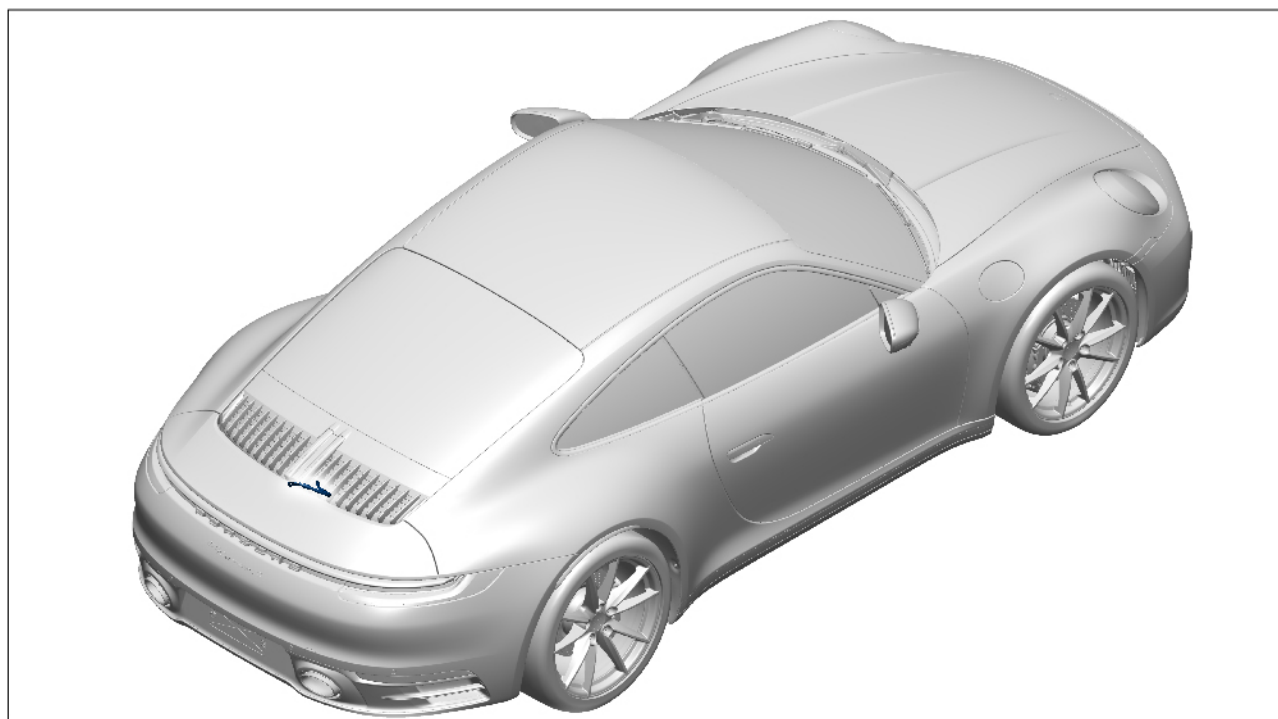

Ground strap installation position

Parts required

Parts Info: **Vehicles with assigned scopes 1 and 2**

Parts required for rework on the screws:

Part No.	Designation	Number
V04015001EB	⇒ External hexalobular screw	1 ea.


Parts Info: **Vehicles with assigned scopes 3 and 4**

Depending on the test result, parts required for replacing the earth wire and for reworking the screw connection:

Part No.	Designation	Number
V04015001EB	⇒ External hexalobular screw	1 ea.
V04015001EH	⇒ Ground line	1 ea.

Checking ground strap and replacing if necessary, reworking screw connection ground point

Work Procedure: 1 Unscrew fastening screw ⇒ *Fastening screw for ground strap -1-* on the ground strap.

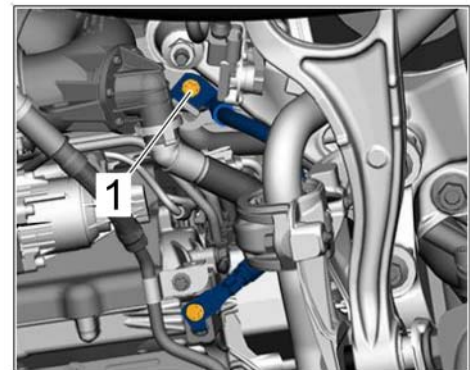

Fastening screw for ground strap

- 2 Check the contact surface of the ground strap for corrosion and damage. ⇒ *Fault type – ground strap and ground screws*



Fault type – ground strap and ground screws

Assessment		Action
(✓)	Contact surface on ground strap is OK .	Brush off contact surface of the ground strap or clean with sandpaper. Install new fastening screw ⇒ <i>Fastening screw for ground strap -1-</i> and tighten Tightening torque 23 Nm (17 ftlb.) . ⇒ <i>Workshop Manual '978719 Removing and installing ground strap for engine'</i>
(x)	Contact surface on ground strap is not OK	Install new ground strap , Part No. V04015001EH with the new fastening screw ⇒ <i>Fastening screw for ground strap -1-</i> . Check that the tightening torque is correct. Tightening torque 23 Nm (17 ftlb.) ⇒ <i>Workshop Manual '978719 Removing and installing ground strap for engine'</i>

- 3 Enter the campaign in the Guarantee and Maintenance booklet.

Warranty processing

Scope 1: **Checking ground strap and reworking threaded joint for ground point**

Labor time:	
Checking ground strap and reworking threaded joint for ground point	Labor time: 38 TU
Includes: Checking contact surface of ground strap Replacing threaded joint for ground point	
Required parts:	
V04015001EB ⇒ External hexalobular screw	1 ea.
⇒ Damage code WMJ2 066 000 2	

Scope 4: **Checking and replacing ground strap and reworking threaded joint for ground point**

Only valid for 911 GT3 (992)

Labor time:	
Checking ground strap, replacing ground strap and reworking threaded joint for ground point	Labor time: 76 TU
Includes: Checking contact surface of ground strap	
Replacing ground strap	
Replacing threaded joint for ground point	
Required parts:	
V04015001EB ⇒ External hexalobular screw	1 ea.
V04015001EH ⇒ Ground line	1 ea.
	(Only if required)
⇒ Damage code WMJ2 066 000 2	

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2022 Porsche Cars North America, Inc.