

<b>Subject:</b>  RATTLE FROM SUNROOF AREA	<b>Service Alert No.:</b> SA-032/22
	<b>Last Issued :</b> 05/11/2022

## BULLETIN NOTES

### APPLICABLE MODEL(S)

2023 CX-50

## DESCRIPTION

Some customers may report a rattle from the sunroof area. Make sure to read the complete repair procedure before attempting any repairs as the sunroof may have rattles from more than one location.

## REPAIR PROCEDURE

### SIDE COVER RATTLE

The noise comes from the side cover vibrating against the assembly at the location marked by the arrow due to poor retention of the cover clips.

1. Test drive the vehicle and if you hear the noise, press the area at the red arrow on both sides of the vehicle.

### Was the noise eliminated?




**YES:** Continue to the next step.

**NO:** Skip to the next section.

2. Remove the side covers from the sides of the sunroof assembly.
3. Bend the mount clips as shown below. If needed, remove them from the covers.

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

**CAUTION: DO NOT bend the clips too far or they will break.**

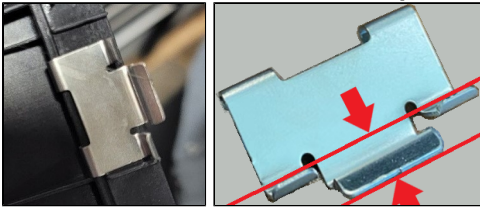

4. Reinstall the trim and retest for the rattle noise.

#### CROSS BRACE RATTLE

The noise comes from the cross brace cover after the vehicle has been driven and the clips loosen. Follow the instructions below to eliminate the noise.

1. Refer to the attached video for a test procedure that does not require a test drive.

**Is there a rattle?**


**YES:** Continue to the next step.

**NO:** Skip to the next section.

2. Remove the rear glass panel using the SUNROOF REAR GLASS PANEL REMOVAL procedure.

3. Remove the pushpins and then remove the trim.

**CAUTION: DO NOT damage the trim as it is only available with the sunroof assembly.**

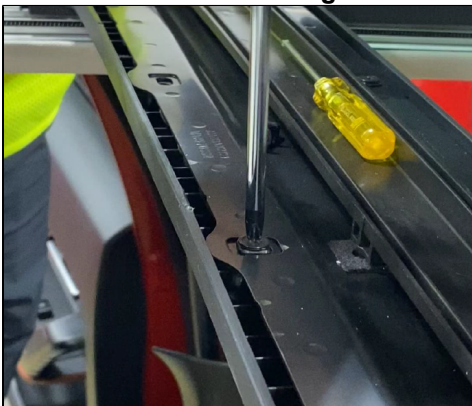

4. Add noise reduction material from the Interior Noise Kit (see below) anywhere the trim makes contact with the frame.



**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

5. Reassemble the trim in the reverse order.

**NOTE:** Make sure the clips are ok and properly reinserted.

6. Reinstall the rear glass using the SUNROOF REAR GLASS PANEL INSTALLATION procedure.

7. Retest for the noise.

8. Test drive the vehicle.

**Do any rattle noises remain from the sunroof area?**

**YES:** Continue to the next section.

**NO:** Return the vehicle to the customer.

#### SUNROOF ASSEMBLY MOUNT POINTS

1. Access the sunroof assembly mounting points using the relevant steps from the PANORAMA SUNROOF UNIT REMOVAL procedure.

2. Check the attaching hardware, and make sure all nuts and bolts are tightened to specification. Refer to the PANORAMA SUNROOF UNIT INSTALLATION procedure for torque specs, location of the hardware, and the relevant final assembly steps.

3. **Were all sunroof rattle noises resolved?**

**YES:** Return the vehicle to the customer.

**NO:** *Create a video of the concern* and then contact the Mazda Technical Assistance Hotline.

#### **PARTS INFORMATION**

**NOTE:** If replacing any existing parts, use the GEPC with the VIN to look up parts to ensure they are the latest version and correct for that VIN.

Part Number	Description	Qty.	Notes
K001-W0-225	Interior Noise Kit	1	This repairs multiple vehicles, do NOT claim the kit for one repair.

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.