

2021 Ascent

1.COMPLAINT: C/S WATER HEATER NOT WORKING AGAIN-MAKES NOISE-NO HEAT-SHOWING ERROR CODE

CAUSE: FAULTY LP REGULATOR

CORRECTION: WATER HEATER SHOWING E31 CODE-CONTACTED TRUMA FOR DIAG ASSISTANCE-CHECKED GAS PRESSURE AND FOUND ONLY 9" OF WC-TOO WEAK TO ACTIVATE HEATER CONTROL-REPLACED REGULATOR-RECHECKED LP SYSTEM PRESSURE-11" OF WC-WATER HEATER WORKING NOW.

LABOR: 1.5 HOURS 1.50 approved.