



## Preliminary Information

### PIP5855 Information on Malfunction Indicator Lamp (MIL) Illuminated with Any Combination of DTCs P0011 P0014 P0016 P0017 Setting

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CT4	2021 - 2022	All	All	2.7L (L3B)	All
Cadillac	CT4-V	2021 - 2022	All	All	2.7L (L3B)	All
Chevrolet	Silverado 1500 (New Model)	2021 - 2022	All	All	2.7L (L3B)	All
GMC	Sierra 1500 (New Model)	2021 - 2022	All	All	2.7L (L3B)	All

Involved Region or Country	North America
Condition	Malfunction Indicator Lamp (MIL) Illuminated with Any Combination of DTCs P0011 P0014 P0016 P0017
Cause	Failed Camshaft Position Actuator Magnet

#### Correction:

Some customers may comment that the Malfunction Indicator Lamp (MIL) is illuminated with Any Combination of DTCs P0011 P0014 P0016 P0017 set current or in history.

If the code or codes are stored current or in history, check for and correct any related wiring, terminal tension, crimp, or lock issues as needed.

If no issues are isolated during the harness inspections, replace the Camshaft Position Actuator Magnet for the code that has set and retest.

If the code or codes reset post Camshaft Position Actuator Magnet Replacement, follow Global Service Information diagnostics to isolate and repair the issue.

#### Version History

Version	1
Modified	05/18/2022 - Created on.



GENERAL MOTORS