



Preliminary Information

PIT5512C Remote Functions Inoperative after First Button Press

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2015 - 2022	All	All	All	All
GMC	Canyon	2015 - 2022	All	All	All	All

Involved Region or Country:	North America
Condition:	Remote functions inoperative after first button press, further operation delayed.
Cause:	Aftermarket LED dome lamps installed.

Correction

The customer may state the remote functions are inoperative or delay after the first button press. (ie. The drivers door unlocks and the second press doesn't unlock the passenger door or the door lock button is pressed, the doors lock but then the RVS does not respond.)

Recommendations / Instructions

The technician is suggested to inspect for aftermarket LED dome lamps installed in the vehicle. These have been found to emit a frequency that blocks the remote functions when the lamps illuminate. If installed they will need to be removed and the original lamps installed to restore proper function.

Version History

Version	4
Modified	06/23/2016 - Created on. 10/16/2019 - Updated to add model years, 12/08/2020- Updated to add the 2021 model year. 05/23/2022- Updated to add the 2022 model year.



GENERAL MOTORS