



Service Bulletin

Bulletin No.: 21-NA-246

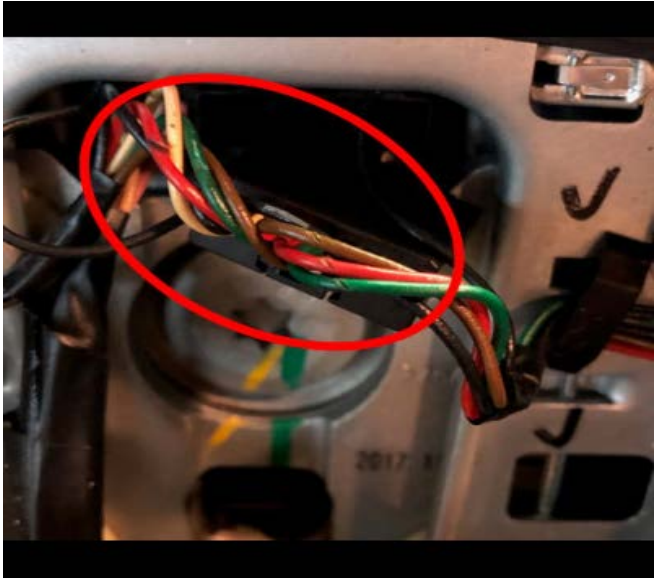

Date: January, 2022

TECHNICAL

Subject: Unwanted Front Windshield Wiper Swipe, Cruise Control Will Not Turn On, Steering Wheel Controls Inoperative, DTCs P155A/00, B1529/03

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Encore	2019	2020	—	—	All	All
Chevrolet	Trax						

Involved Region or Country	North America
Condition	<p>Some customers may comment on one or more of the following conditions:</p> <ul style="list-style-type: none">• Unwanted front windshield swipe upon starting or powering up the vehicle.• Front wipers will not park.• Steering wheel controls inoperative or erratic operation.• Upon a vehicle scan check, DTCs P155A/00, B1529/03 might be stored current or in history.

<p>Cause</p>	 <p style="text-align: right;">5480325</p>  <p style="text-align: right;">5480327</p> <p>The cause of the condition may be the steering wheel harness shorted under the steering wheel inflator module.</p>
<p>Correction</p>	<p>If you encounter a vehicle with the above concern, inspect and repair the steering wheel harness referring to the proper wire repair procedures. Refer to <i>Wire to Wire Repair</i> in SI.</p>

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
7486098*	Steering Wheel Harness Repair	0.6 hr
*This is a unique Labor Operation for bulletin use only.		

Version	2
Modified	Released November 03, 2021 January 19, 2022 – Changed DTC P1529 to B1529.

