



Service Bulletin

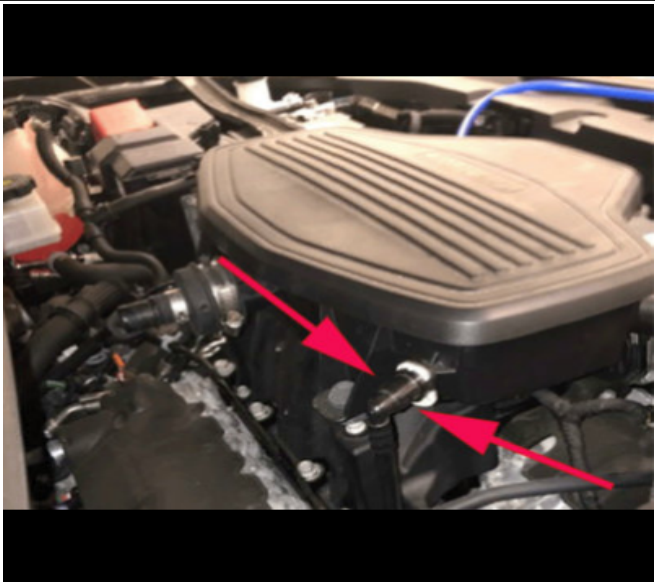
Bulletin No.: 21-NA-254

Date: February, 2022

TECHNICAL

Subject: Whistle or Squeak or Squeal Noise from the Engine Compartment Area

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Blazer	2019	2020			LGX	

Involved Region or Country	North America, Middle East, Israel, Palestine, Chile (West), Colombia (West), Ecuador (West), Peru (West)
Condition	Some customers may comment that a whistle, squeal, or squeak noise from the engine area. – This noise may get more noticeable after driving for a while.
Cause	 <p style="text-align: right;">5921953</p> <p>This condition may be caused by plastic flashing restricting the clean air-port on the air cleaner duct on top of the engine as shown below. – The restriction or flashing will appear that the hole is not drilled out completely and can be seen about 2 inches inside the tube.</p>
Correction	To correct this condition, replace the air cleaner duct and reevaluate for a noise concern. Run the engine long enough to build up crankcase pressure during testing to ensure correction.

Service Procedure

Refer to *Air Cleaner Outlet Duct Replacement* in SI.

Parts Information

No parts are required for this repair.

Causal Part	Description	Part Number	Qty
N/A	DUCT, A/CI OTLT	84540981	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4020690	Air Cleaner Outlet Duct Replacement	Use the Published Labor Operations Time

Version	1
Modified	Released January 27, 2022

