



Service Bulletin


Bulletin No.: 21-NA-290

Date: January, 2022

TECHNICAL

Subject: Wrinkle or Bubble in Stripe or Hood Wrap forming Around Outer Edges of Hood Air Scoop

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro	2019	2022	—	—	—	—

Involved Region or Country	North America
Additional Options (RPOs)	SS, SS 1LE
Condition	<div style="text-align: center;">  </div> <p style="text-align: right; font-size: small;">5937945</p> <p>Some customers may comment on a wrinkle or bubble in the stripe or hood wrap forming around the outer edges of the hood air scoop.</p>
Cause	This condition may be caused by edges on the bottom of the hood air scoop pressing deep into the stripe or hood wrap, causing air pockets to form over time.
Correction	If you encounter a vehicle with the above concern, refer to the Service Procedure below.

Service Procedure



5937948

1. Remove the hood air scoop from the hood. Refer to *Hood Air Scoop Replacement (ZL1 with A1Y)* in SI.



5938040

2. With the hood air scoop facing downward, locate the inner and outer tuning ribs.



5938000

3. Using sandpaper, sand down the ribs.
 4. For better clearance between the air scoop and the hood, add an additional layer of foam tape on top of the existing tape.
- Note:** Before wrapping the edges where the hood air scoop is mounted, mix a chemical solution that will contain 70% Isopropyl alcohol mixed to a ratio of 25% alcohol to 75% water. Use this to spray the adhesive side and then wrap it over the edges. This will help provide extra adhesion.
5. Remove the decal striping or wrap from the hood in preparation for the new striping or hood wrap to be installed.
 6. Install the new striping or hood wrap.
 7. Once the striping or hood wrap is installed, wait 30 minutes to allow for curing.
 8. Re-install the hood air scoop. Refer to *Hood Air Scoop Replacement (ZL1 with A1Y)* in SI.

Parts Information

Causal Part	Description	Part Number	Qty
N/A	Decal, Hood (Black)	84406072	1
N/A	Decal, Hood (Carbon Flash Met) (Solid)	84279199	1
N/A	Decal, Hood (Abalone White Tri) (Solid)	84279198	1
N/A	Decal, Hood (Switchblade Silver Met) (Solid)	84279200	1
N/A	Decal, Hood (White) (Rally Hood)	84633025	1

Causal Part	Description	Part Number	Qty
N/A	Decal, Hood (Carbon Flash) (Rally Hood)	84633026	1
N/A	Decal, Hood (Silver) (Rally Hood)	84633027	1
N/A	Decal, Hood (Carbon Flash) (Hood Center Stripe)	84793282	1
N/A	3M Vinyl Foam Tape*	4726	As Required

*There is enough material to service multiple vehicles. Store the remaining material for future use.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
1481598*	Sand Ribs and Add Foam to Air Scoop	0.5 hr
Add	Installation of 1LE Hood Wrap	4.0 hrs

*This is a unique Labor Operation for bulletin use only.

Version	1
Modified	Released January 05, 2022

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION