

# **Service Bulletin**

Bulletin No.: 21-NA-238

Date: February, 2022

# **TECHNICAL**

**Subject: Transmission Fluid Leak Near Bellhousing Area** 

Brand:	Model:	Model Year:		VIN:		Engine	Transmission:
		from	to	from	to	Engine:	ITAIISIIIISSIOII.
Chevrolet	Silverado 2500HD/3500HD	0000	2022			LED	MCM MCU
GMC	Sierra 2500HD/3500HD	2020				L5P	MGM, MGU

Involved Region or Country	North America, Australia, New Zealand.		
Condition	Some customers may comment that a transmission fluid leak is coming from the bellhousing inspection cover.		
Cause	This condition may be caused by the Automatic Transmission Case Front Cover Seal may be rolled or damaged		
Correction	If the leak has been verified to be coming from the front cover seal, replace the Automatic Transmission Case Front Cover Seal and the Torque Converter Fluid Seal.		

#### **Service Procedure**

Refer to Automatic Transmission Case Front Cover Removal in SI and Torque Converter Fluid Seal Replacement in SI.

### **Parts Information**

Causal Part	Description	Part Number	Qty
Х	SEAL, T/C FLUID	24293986	1
Х	SEAL AUTO TRANS FRT CASE COVER	24277112	1
N/A	BOLT, TRNS MNT	11548787	2
N/A	NUT, TRNS MNT	11548414	3
N/A	SEAL, OUTPUT SEAL SQUARE CUT	24286193	1
N/A	FLUID, AUTO TRNS ULV	19352619 (U.S.) 19352620 (Canada)	8

Page 2 February, 2022 Bulletin No.: 21-NA-238

## **Warranty Information**

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8466580	Automatic Transmission Case Front Cover Seal Replacement	Use the Published Labor Operations Time

Version	2
Modified	Released November 09, 2021 Revised February 17, 2022 - Add 2022 to Model Year.