

## **Service Bulletin**

Bulletin No.: 22-NA-025

Date: February, 2022

## **TECHNICAL**

Subject: Belt Chirp Noise and-or Harmonic Balancer Rubbing on Timing Cover

This bulletin replaces PIP5742. Please discard PIP5742.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
Di aliu.	woder.	from	to	from	to		
Chevrolet	Silverado HD	2019	2020			6.6 L5P	
GMC	Sierra HD					0.0 LSP	
Chevrolet	Silverado 4500HD, 5500HD, 6500HD					L5D	

Involved Region or Country	North America, Middle East, Israel, Palestine		
Condition	Some customers may comment on a belt chirp noise and/or metal to metal noise.		
Cause	This condition may be caused by the outer ring of the harmonic balancer may slide backward and cause a misalignment of the belt  — The outer ring may slide back far enough to contact the timing cover and oil pan(s)		
Correction	Inspect the harmonic balancer, timing cover and oil pans for possible contact. Refer to the Service Procedure for examples.		

## **Service Procedure**

Refer to service information for proper procedures:



5621077

- Harmonic balancer damage due to contact.




5621078

Separation of the harmonic balancer's inner and outer rings.



5627017

 The new damper has a hub that is longer than the inertia ring. Movement can be identified by inspecting the hub directly at the elastomer. Look for a witness mark of where the elastomer was originally positioned.

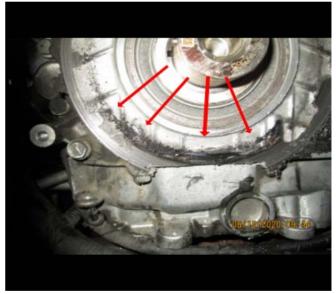

5621076

- Damage to the timing cover and upper oil pan.



5621075

- Damage to the timing cover and upper oil pan.

## **Warranty Information**

**Note:** Only use the Labor Operation that coincides with the repair performed.

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4063250	Crankshaft Pulley Replacement	Use Published Labor Times
4063610	Engine Front Cover Replacement	
4065910	Lower Oil Pan Replacement	
4065890	Upper Oil Pan Replacement	

Version	1
Modified	Released February 02, 2022