



# Service Bulletin

Bulletin No.: 22-NA-027

Date: February, 2022



## TECHNICAL

**Subject: LM2 Diesel With Possible Oil Consumption - DTC P06DD Set**

**The bulletin replaces PIP5762. Please discard PIP5762.**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2021	2022			LM2	
Chevrolet	Silverado 1500	2020	2021				
	Silverado 1500 - (LTD, RPO J21, 12th VIN Digit = 4 or less)	2022	2022				
	Silverado 1500 - (RPO J22, 12th VIN Digit = 5 or greater)						
	Suburban	2021	2022				
	Tahoe						
GMC	Sierra 1500	2020	2021				
	Sierra 1500 - (LIMITED, RPO J21, 12th VIN Digit = 4 or less)	2022	2022				
	Sierra 1500 - (RPO J22, 12th VIN Digit = 5 or greater)						
	Yukon Models	2021	2022				

<b>Involved Region or Country</b>	North America, Russia, Middle East, Chile (West), Colombia (West), Ecuador (West), Paraguay (West), Peru (West), Japan, Cadillac Korea (South Korea), Thailand (ASEAN), Australia/New Zealand
<b>Condition</b>	Some customers may comment on oil consumption. Some technician may find DTC P06DD set.
<b>Cause</b>	Camshaft housing (cover) may have a baffle plate weld that is not adequate.

<p><b>Correction</b></p>	<div style="text-align: right; margin-bottom: 10px;">5671019</div>  <div style="text-align: right; margin-bottom: 10px;">5671020</div>  <ul style="list-style-type: none"> <li>• If the serial number is greater than 21298JDXXX, this bulletin does not apply. Refer to bulletin 21-NA-272 and SI for appropriate diagnostics.</li> <li>• If the serial number is less than 21298JDXXX and the customer's concern is oil consumption:             <ol style="list-style-type: none"> <li>1. 1) Replace the camshaft housing cover.</li> <li>2. 2) Replace the #2 glow plug.</li> </ol> </li> </ul> <p>Re-evaluate the oil consumption.</p>
--------------------------	--

**Service Procedure**

Refer to *Camshaft Housing Cover Insulator Replacement* in the Service Manual and *Glow Plug Replacement - Cylinder 2* in the Service Manual.

**Parts Information**

Use the vehicle identification number (VIN), SI, and the GM Electronic Parts Catalog to determine the correct part to order.

**Warranty Information**

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4087688*	Replace camshaft housing and glow plug	8.1 Hrs.
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	Released February 02, 2022

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY  
TECHNICIAN  
CERTIFICATION