



# Technical Service Bulletin

---

## 90 Instrument cluster: various warning LEDs light up unexpectedly

90 22 69 2067183/2 June 6, 2022. Supersedes Technical Service Bulletin Group 90 number 22-66 dated May 27, 2022, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q5, Q5 Sportback, SQ5, and SQ5 Sportback	2022	000001 – 0037661	TOP Instrument cluster

## Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Corrected display issue
1	05/27/2022	Initial publication

### Customer states:

Various unexpected indicator LEDs light up intermittently in the instrument cluster while driving.

The phenomenon is triggered when one or more green LEDs light up, for example when the adaptive cruise control is activated.

The complaint resolves itself after an ignition cycle.

### Workshop findings:

No relevant DTCs are stored.

## Technical Background



# Technical Service Bulletin

---

A calibration tolerance issue may cause the issue in certain instrument clusters.

## Production Solution

Optimized tolerance calibration values are used for newly produced parts.

## Service

Please replace the Instrument Cluster -J285- (diag. addr. 0017) according to the service instructions in Elsa.

## Warranty

Claim Type:	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• G10 for CPO Covered vehicles – Verify Owner.</li><li>• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li></ul>		
Service Number:	9025		
Damage Code:	0040		
Labor Operations:	Replace instrument cluster	9025 5500	See SRT with associated operations
	GFF	0150 0000	Time stated on the diagnostic protocol (Max 50 TU)
Diagnostic Time:	Road test prior to the service procedure	No allowance	0 TU



# Technical Service Bulletin

	Road test after the service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB 2067183/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
See ETKA	Instrument Cluster	01

## Additional Information

All parts and service references provided in this TSB (**2067183**) are subject to change and/or removal.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.