

**SSM 50870 - 2022 Bronco - 2.3L - Charging System Fault Message In The Instrument Panel Cluster (IPC) With DTCs U012D, U0284 And/Or U0285 - Built On 01-APR-2022 And Through 08-APR-2022**

Some 2022 Broncos equipped with a 2.3L engine and built on 01-Apr-2022 and through 08-Apr-2022 may exhibit a charging system fault message displayed in the IPC and diagnostic trouble codes (DTCs) U012D, U0284 and/or U0285 stored in the powertrain control module (PCM). This may be due to a poor electrical connection at connector C1104B, pin 1 (circuit VE181) located at the generator. To correct this condition, replace connector C1104B with a service pigtail replacement service part number: LU2Z-14S411-ACA.

APPLICABLE VEHICLES  
2022 TRUCK: G1 U725N BRONC