



# Service Bulletin


Bulletin No.: 20-NA-104

Date: June, 2022

## INFORMATION

**Subject:** Malfunction Indicator Lamp (MIL) Illuminated – 5V Reference, Reduced Power, Extended Crank, Body Harness to Fuel Tank Damage

| Brand:    | Model:                          | Model Year: |      | VIN: |    | Transmission: | Engine: |
|-----------|---------------------------------|-------------|------|------|----|---------------|---------|
|           |                                 | from        | to   | from | to |               |         |
| Chevrolet | Camaro SS, and SS 1LE (RPO A1Y) | 2017        | 2023 | —    |    | All           | All     |
|           | Camaro ZL1                      |             |      |      |    |               |         |
|           | Camaro ZL1 1LE (RPO A1Z)        | 2018        |      |      |    |               |         |

|                                   |  |
|-----------------------------------|--|
| <b>Involved Region or Country</b> | North America, Europe, Russia, Middle East, Israel, Argentina, Brazil, Bolivia, Chile, Colombia, Ecuador, Paraguay, Peru, Uruguay, Japan, GM Korea Company, China, Taiwan                                |
| <b>Condition</b>                  | Some customers may comment on a Malfunction Indicator Lamp illuminated, extended crank or reduced power.   |
| <b>Cause</b>                      |  <p style="text-align: right;">5599085</p> <p>This concern may be caused by a damaged body to fuel pump harness.</p> |

|                          |  |
|--------------------------|--|
| <p><b>Correction</b></p> |  <p style="text-align: right; font-size: small;">5599088</p> <p>Inspect the left rear wheelhouse liner for a rub through condition due to incorrect tire size.</p> |
|--------------------------|--|

**Service Procedure**

If you encounter a vehicle with the above concern, inspect the left rear wheelhouse liner for a rub through condition.

- If the concern is caused by a rub through condition and the vehicle is not equipped with original equipment (OE) tires, then advise the customer of the importance to use the same tire size and manufacturer as the vehicle was originally equipped with. The repair is not covered as a warranty claim.

**Important:** The same tire size, but a different manufacturer, could result in up to 10 mm difference in actual tire size.

- If the concern is caused by a rub through condition and the vehicle is equipped with the OE tires, please submit a field product report and include pictures and tire information.

**Tire Information**

**SS 1LE / ZL1**

|       | Location    | Tire Size | Description                |
|-------|-------------|-----------|----------------------------|
| Front | P285/30ZR20 |           | Goodyear Eagle F1 Supercar |
| Rear  | P305/30ZR20 |           | Goodyear Eagle F1 Supercar |

**ZL1 1LE**

|       | Location    | Tire Size | Description                   |
|-------|-------------|-----------|-------------------------------|
| Front | P305/30ZR19 |           | Goodyear Eagle F1 Supercar 3R |
| Rear  | P325/30ZR19 |           | Goodyear Eagle F1 Supercar 3R |

|                 |   |
|-----------------|---|
| <b>Version</b>  | 3   |
| <b>Modified</b> | Released May 12, 2020<br>October 14, 2020 – Added the 2021 Model Year and updated the Involved Region or Country section.<br>June 24, 2022 – Added the 2022–2023 Model Years and the Camaro SS model. |

