



# Service Bulletin


Bulletin No.: 22-NA-126

Date: June, 2022

## TECHNICAL

**Subject: Automatic Emergency Braking (AEB) Forward Collision Icon Lamp On with No DTCs Present**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Envision	2021	2022	—	—	—	—
Cadillac	CT4	2020	2022				
	CT5	2020					
	Escalade	2021					
	Escalade ESV	2021					
Chevrolet	Silverado 1500 New (RPO J22, VIN Digit 5 = A / D)	2022	2022				
	Suburban	2021	2022				
	Tahoe						
GMC	Hummer EV	2022	2022				
	Sierra 1500 New (RPO J22, VIN Digit 5 = H / U)	2022	2022				
	Yukon	2021	2022				
	Yukon XL						

<p><b>Involved Region or Country</b></p>	<p>North America, Chile, Colombia, Ecuador, Peru, Europe, Uzbekistan, Russia, Middle East, Israel, Palestine, Japan, GM Korea Company, Cadillac Korea (South Korea), Thailand</p>
<p><b>Condition</b></p>	<p>Some customers may comment on an AEB forward collision icon lamp illuminated in the cluster. No DTCs are present as well as both lane keep assist and cruise are functional.</p>  <p style="text-align: right;">6100231</p>
<p><b>Cause</b></p>	<p>The cause of this condition may be due to the customers vehicle collision settings. The Pedestrian Detection or Forward Collision settings may be set to anything other than 'Alert and Brake.'</p>
<p><b>Correction</b></p>	<p>To correct this condition, set the Pedestrian Detection and Forward Collision settings to 'Alert and Brake.' If the customer does not want automatic braking enabled, then it is normal for this icon to be illuminated to inform the driver of reduced features.</p> <p>Go to the vehicle settings =&gt; collision detection systems =&gt; front pedestrian detection. Verify the setting is set to "alert and brake."</p> <p><b>Important:</b> If the setting is alert and brake and the AEB light is still on, restore the radio to factory settings.</p>

## Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
3487408*	AEB Light Reset	0.4 hr
*This is a unique Labor Operation for bulletin use only.		

Version	1
Modified	Released June 20, 2022

