

SSM 50935

2022 Navigator - Rear Interior Power Liftgate Switch Inoperative

Some 2022 Navigator vehicles may experience an inoperative rear interior power liftgate switch. This may be due to a water ingress condition into the rear liftgate. If moisture or corrosion is found in the liftgate switch and/or connector, repair any water leaks prior to switch and/or connector replacement. Check all liftgate seals between liftgate trim panel and liftgate door for proper position and orientation, including seals with the liftgate glass open. Perform water ingress leak path testing on liftgate door. Refer to Workshop Manual (WSM), Section 501-00 > Body System > General Information > Diagnosis and Testing > Dust and Water Leaks.