



Bulletin No.: PIC6462  
Published date: 06/20/2022

# Preliminary Information

## PIC6462 Mode Control Cable Kinks - Mode Control Inoperative C60 Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Spark	2016 - 2020	All	All	All	All


Involved Region or Country	North America
----------------------------	---------------

Additional Options (RPO)	C60 - Manual HVAC
--------------------------	-------------------

Condition  
Some customer may comment that they are not able to change the HVAC modes or there is no air flow from the defroster vents.  
Upon inspection, the tech may find that the mode control cable is bent.





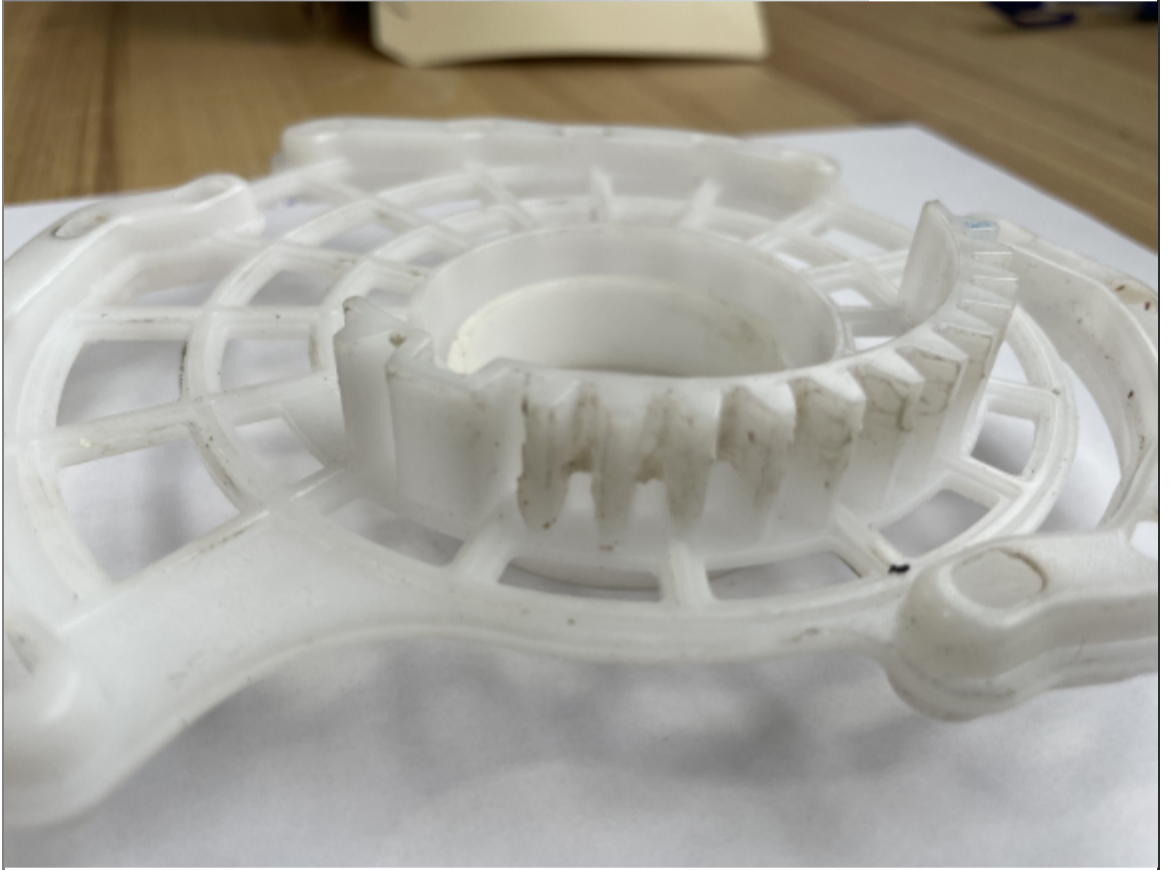



Cause	This condition may be due to a combination of increased resistance from debris in the mode valve link assembly and high air flow (fan speeds above the setting of 3) against mode doors from the blower motor.
-------	--

**Correction:**

If the above conditions are found, the tech will need to inspect the mode valve link assembly for debris or damage.

If debris is found, clean the link assembly and re-install or replace as needed.

Then, replace the mode control cable.

Parts Information

Description	Part Number	QTY
Mode Control Cable	95388253	1
Mode Valve Link	94513084	1

Version History

Version	1
Modified	06/20/2022 - Created.



GENERAL MOTORS