



TECHNICAL SERVICE BULLETIN

2021-2022 Bronco - Whistle Noise From Left Exterior Mirror

22-2297

21 July 2022

This bulletin supersedes 22-2215.

Model:

Ford 2021-2022 Bronco

Summary

This article supersedes TSB 22-2215 to update the labor time information.

Issue: Some 2021-2022 Bronco vehicles equipped with base exterior mirrors (does not have integrated puddle lamps and/or turn signal lamps) may have a whistle noise that originates from the left exterior mirror. This may be due to the design of the exterior mirror cover. To correct this condition, follow the Service Procedure to replace both the left and right exterior mirror covers.

Action: Follow the Service Procedure to correct the condition on vehicles that meet all of the following criteria:

- 2021-2022 Bronco
- Equipped with base exterior mirrors (does not have integrated puddle lamps and/or turn signal lamps)

Parts

Service Part Number	Quantity	Description
M2DZ-17D742-F	1	Mirror Cover, Molded In Color, Right
M2DZ-17D743-H	1	Mirror Cover, Molded In Color, Left
M2DZ-17D742-BBPTM	1	Mirror Cover, Painted, Right
M2DZ-17D743-BCPTM	1	Mirror Cover, Painted, Left

Warranty Status: Eligible under provisions of New Vehicle Limited Warranty (NVLW)/Service Part Warranty (SPW)/Special Service Part (SSP)/Extended Service Plan (ESP) coverage. Limits/policies/prior approvals are not altered by a TSB. NVLW/SPW/SSP/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2021-2022 Bronco: Inspect And Replace Both (2) Exterior Mirror Covers (Do Not Use With Any Other Labor Operations Outside Of this Article)	222297A	0.6 Hrs.
Additional Time To Paint New Mirror Covers When Required (Can Be Claimed With Operation A)	MT222297	Actual Time


Repair/Claim Coding

Causal Part:	17D742
Condition Code:	42

Service Procedure

1. Does the left exterior mirror have 3 horizontal fins on the outboard side of the mirror cover? (Figure 1)

Figure 1 - Left side shown, right side similar

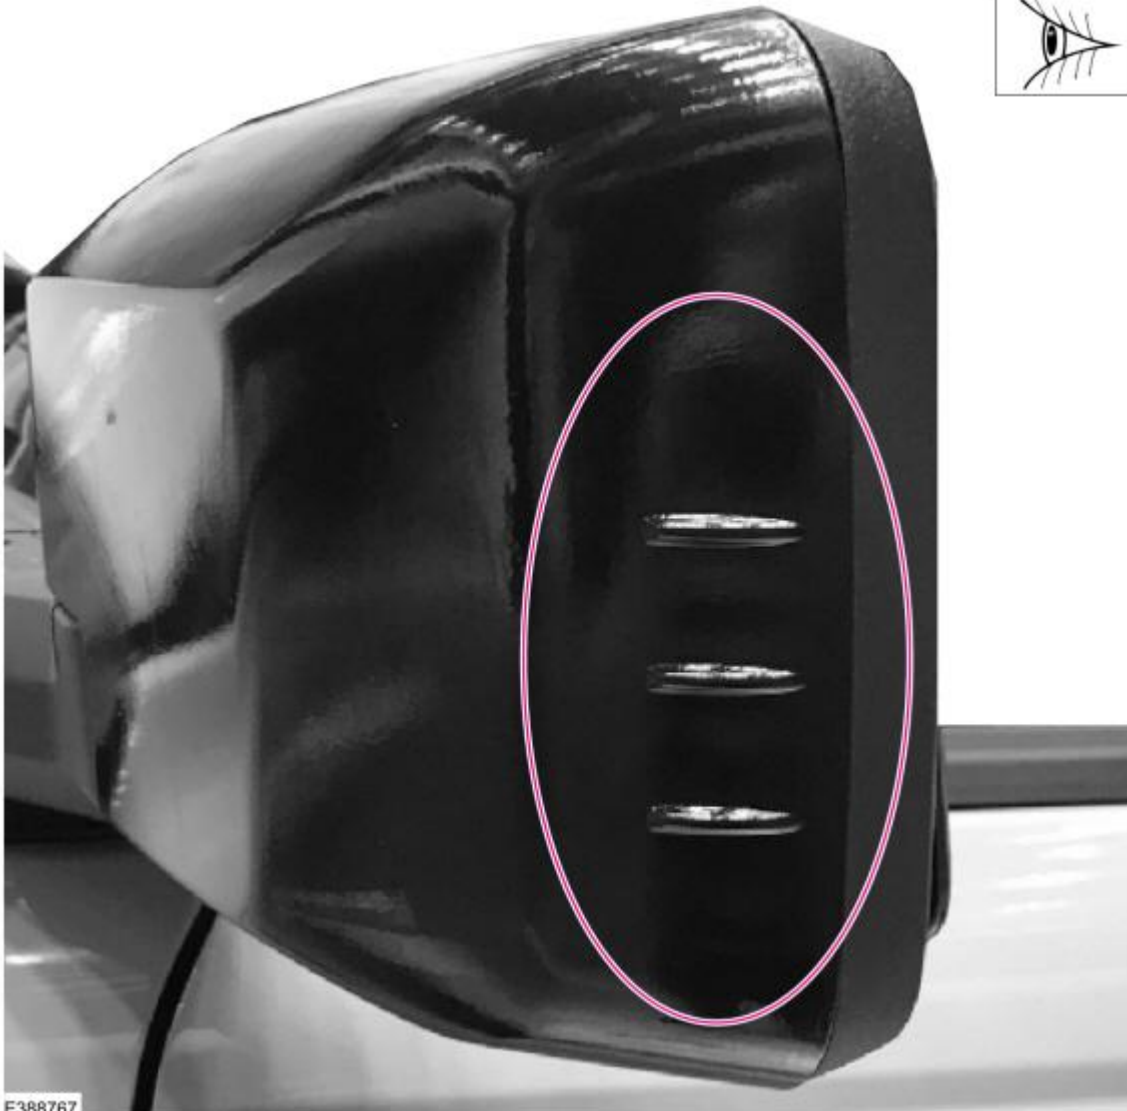

E388767

- (1). Yes - this article does not apply. Refer to Workshop Manual (WSM), Section 100-04 and continue with normal diagnostics.
- (2). No - replace both the left and right exterior mirror covers. Refer to WSM, Section 501-09. Both the left and right exterior mirror covers must be replaced to maintain a consistent vehicle appearance.

© 2022 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.