




GROUP	MODEL
CHA	2022MY Forte (BD/BDm)
NUMBER	DATE
115	July 2022

TECHNICAL SERVICE BULLETIN

SUBJECT: **SERVICE ACTION: BRAKE PEDAL ASSEMBLY INSPECTION AND REPLACEMENT (SA501)**

This bulletin provides information to inspect and, if necessary, replace the brake pedal assembly on some 2022MY Forte (BD/BDm) vehicles produced from March 17, 2022 through April 27, 2022, which may have improper welding between the cowl bracket and brake member, that may result in squeak or pop noise during brake pedal application. This issue does not affect brake performance. Follow the procedure outlined in this publication to identify and replace affected brake pedal assemblies. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.

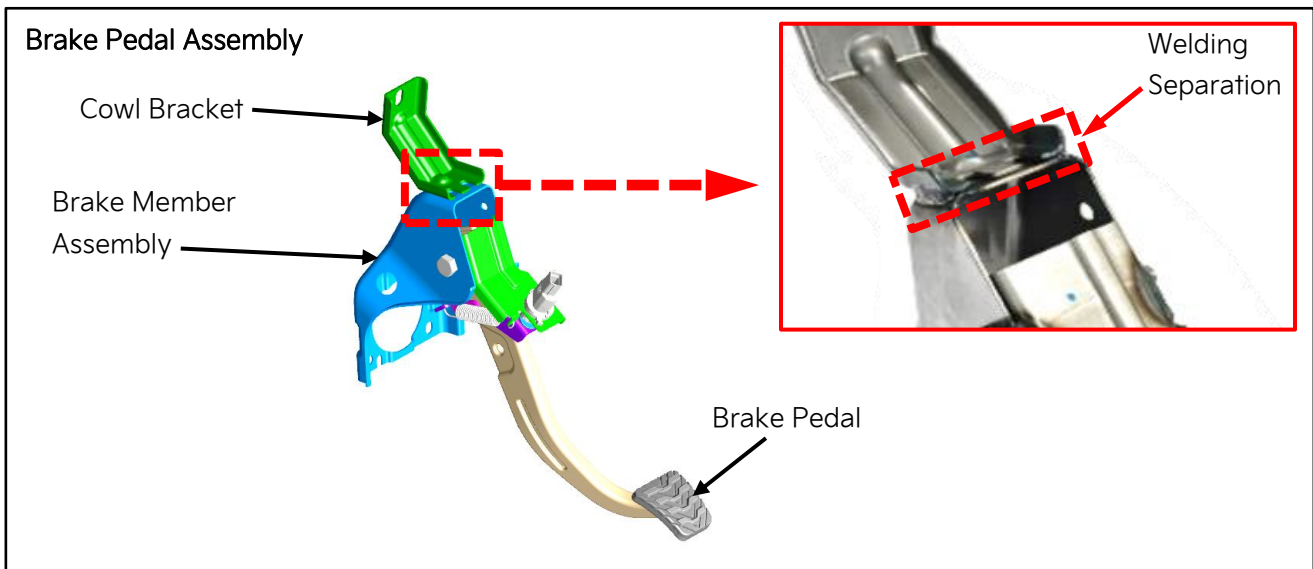

NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.



This issue number is SA501.

SUBJECT:

SERVICE ACTION: BRAKE PEDAL ASSEMBLY INSPECTION AND REPLACEMENT (SA501)

Inspection Procedure:

- 1a. Locate the brake pedal assembly (A) and look for a painted blue dot (B) on the flat surface of the brake pedal assembly bracket, above the brake pedal switch (C) where shown.
- 1b. Identify the color of the dot on the area shown:
 - **Blue (NG):** Proceed to the 'Replacement Procedure' below to replace the brake pedal assembly.
 - **Other color (OK):** If the dot is any color other than blue, this service action is complete. No further action is required.

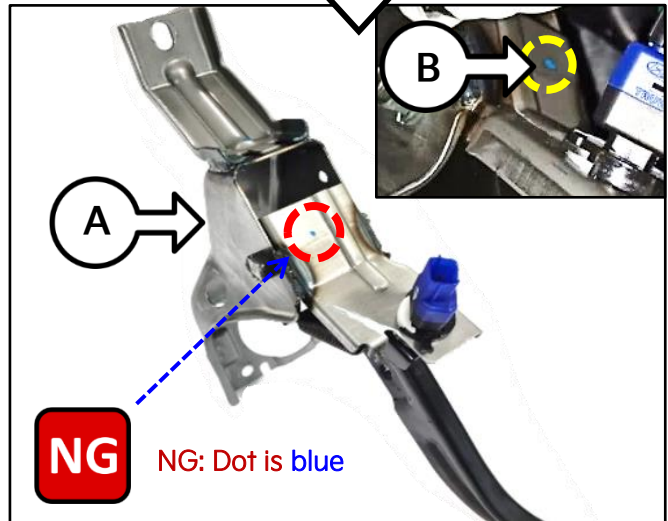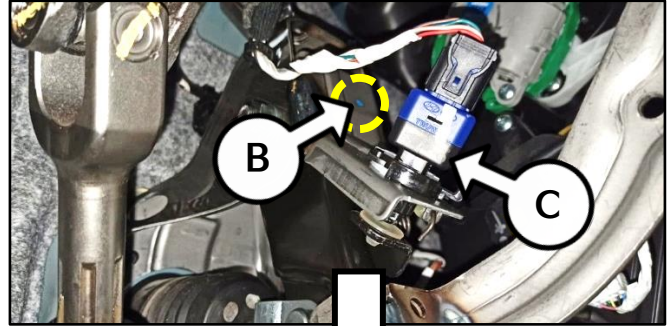

Replacement Procedure:


1. Remove and replace the brake pedal assembly (A) by referring to the "Brake System → Brake System → Brake Pedal → Repair procedures" chapter in the applicable Shop Manual on KGIS.



Tightening torque for mounting nuts:
12.3 - 18.8 lb.ft (16.7 - 25.5 N.m)

Note: The new brake pedal assembly also includes a new 'pre-adjusted' brake switch (B).

2. Reinstall all removed parts in reverse order of removal.
3. Confirm normal operation of the brake pedal and brake lights.

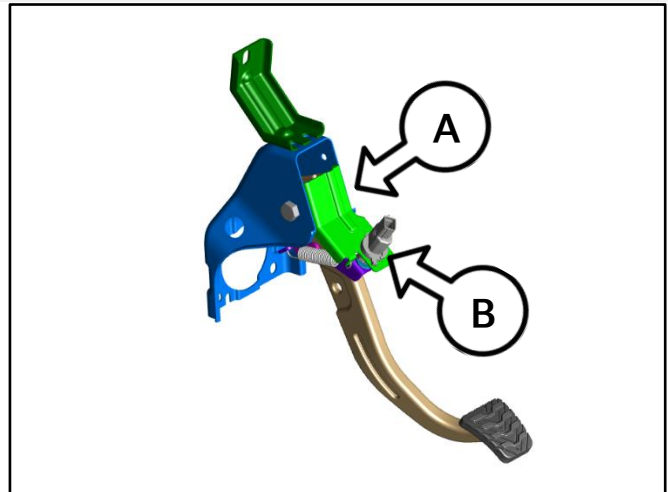


SUBJECT:

SERVICE ACTION: BRAKE PEDAL ASSEMBLY INSPECTION AND REPLACEMENT (SA501)

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Forte (BD/BDm)	March 17, 2022 to April 27, 2022

REQUIRED PART:

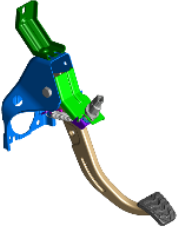Part Name	Part Number	Figure	Qty.
Brake Pedal Assembly	32800 J3200		1
	32800 M6110		
	32800 M6210		

Note: Refer to EPC for correct part number according to the vehicle's VIN.

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	32800 J3200	0	(SA501) Brake Pedal Inspection	220M12R0	0.2 M/H	N/A	0
			(SA501) Brake Pedal Inspection + Brake Pedal Assembly Replacement*	220M12R1	0.6 M/H	32800 J3200 <u>or</u> 32800 M6110 <u>or</u> 32800 M6210	1

***Note:** When necessary, manually enter sublet code 'X2' for reimbursement of one roundtrip rideshare expense or up to three (3) days of rental for brake pedal assembly replacement. Attach supporting documentation.

📄 NOTICE

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference **SA501** when accessing the WebDCS system.