

MAS003118 (MSC 22-21)

Campaign 494  
FROM Maserati TSO  
TO Maserati Network



## Service Campaign 494 MC20 - Fender Bracket Sealing Detachment



DATE: JUNE 10 2022

Certain Maserati MC20 MY21-MY22 vehicles listed in ModisCS+ are involved in a Service Campaign to prevent the detachment of the fender bracket seal.

This action is needed because the seal could be detaching from the fender cover. A check for sealing adhesion is needed to prevent any customer complaints.

We remind that this issue has only an aesthetic impact because no noise or water infiltration can be noticed with an improper adhesion of the sealing.

Please read and review this bulletin first before starting the procedure.  
If you have any questions, contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk. ([MaseratiTechsupport@maserati.com](mailto:MaseratiTechsupport@maserati.com))

Thank You for your continued support and cooperation.

# Operational Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check in ModisCS+ to see if the vehicle is involved in this campaign and if the campaign has not been previously performed.
2. Open the door to inspect the sealing of the fender bracket.



3. Only If the sealing adhesion is compromised, like in the below pictures, the complete rear lateral seal must be replaced.



4. Repeat the same check on the passenger side.

# Replacement Procedure

## Preparations:

- Before performing this operation, please follow the indicated procedure for interior protection: **00.AA.005 - INTERIOR VEHICLE PROTECTION**
- Replacement procedure is identical for both driver and passenger side
- Please replace only the seal that is defective.

1. Outside the vehicle, move the protection (1) and undo the indicated screw.



2. Undo the indicated screws:



3. Undo the indicated screw:



4. With utmost care, remove the lateral seal (1).



5. Refit all the parts you have removed following the removal procedure in reverse order.
6. Check for correct fitment and profiling of the gaskets.
7. The procedure is complete.

## Spare Parts

For this action, only the defective component must be replaced. Please order the PN depending by the side.

| Description                   | QTY | Code         |
|-------------------------------|-----|--------------|
| Complete RH Rear Lateral Seal | 1   | PN 670182193 |
| Complete LH Rear Lateral Seal | 1   | PN 670182194 |

## Warranty Claim

Complete the warranty claim as follows:

| Description                | Code              |
|----------------------------|-------------------|
| Campaign Number            | 494               |
| Warranty Code              | 23                |
| Fault Code                 | 063               |
| Component Code             | 9.06.008          |
| Operation Code             |                   |
| Check                      | 9.06.008.A (0,05) |
| Check + Replace one side   | 9.06.008.B (0,20) |
| Check + Replace both sides | 9.06.008.C (0,35) |