

MAS003153/A (MSC 22-19)

Campaign 511
FROM Maserati TSO
TO Maserati Network



Service Campaign 511 MC20 - ECM Software Update



DATE: JUNE 3 2022

Certain Maserati MC20 (M240) vehicles listed in ModisCS+ are involved in a Service Campaign concerning the ECM Software Update to improve the performance of the engine calibration.

This new Software will improve the detection strategy of the DMTL system, avoiding the improper activation of the DTC P2407 that could cause warning lights or messages on the cluster. Also, the improper activation of the DTC P01C9/P0088, related to the Engine Fuel pressure not at Target, will be cured with this update.

Please read and review this bulletin first before starting the procedure.
If you have any questions, contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk. (Maseratitechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure



Prerequisites: EVO SW version Montecarlo 8.0.4 or greater is required.

Previous MD-EVO SW versions are not compatible with this update.

Performing the update with EVO hardwired to the VCI2 is recommended.

1. Always check in ModisCS+ to see if the vehicle is involved in this campaign and if the campaign has not been previously performed.
2. Before proceeding, please ensure that the Engine is OFF.
3. Connect the MD EVO to the VCI2 using the USB cable.
4. Connect the VCI2 to the vehicle.
5. Key ON Engine OFF (KOEO) check battery voltage and ensure it is 12V or above.
6. With the MD EVO select **ECM ► ECU Programming**.
7. Perform a "PROXI Alignment". In Vehicle View select: ► **BCM ► Procedures ► PROXI ALIGNMENT**
8. Procedure completed.

The SW Below (or further) must be installed

Market	F188 Old	F188 New
NAFTA	670220828	670295368

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Campaign Number	511
Warranty Code	23
Fault Code	063
Component Code	1.90.001
Operation Code	1.90.001.A (0,25)