

Seal on Mirror Attachment Point Wrinkled: Replacing Spacer Between Mirror Attachment Point and Door Seal (212/21)

Vehicle Type: **911 Turbo (992)/911 GT3 (992)**

Model Year: **As of 2021 up to 2022**

Concerns: **Door seal on mirror attachment point**

Information: Customers are complaining that the door seal on the mirror attachment point wrinkles. This is caused by the lightweight shims, which are thicker and sharper than the safety glass (ESG). As a result, the door seal will spring up when the lightweight shims close.
The fault type can occur on the driver's and/or passenger's side.

Action required: Insert a spacer between the mirror attachment point and door seal to prevent the problem from occurring again.

Parts required

Parts Info: **Parts required per vehicle side:**


Part No.	Designation - Location	Number
9P1837779B	⇒ Spacer (3 mm)	1 pc.
99153732000	⇒ Felt	1 pc.

Preparatory work

Work Procedure: 1 Remove front door panel.
For instructions, see:
⇒ *Workshop Manual '705919 Remove and install front door panel'*

Repairing door seal

Work Procedure: 1 Install spacer ⇒ *Position of spacer and felt strip -1-* underneath the lug as shown in ⇒ *Position of spacer and felt strip* .
2 Affix felt strips ⇒ *Position of spacer and felt strip -2-* above the lug as shown in ⇒ *Position of spacer and felt strip* .

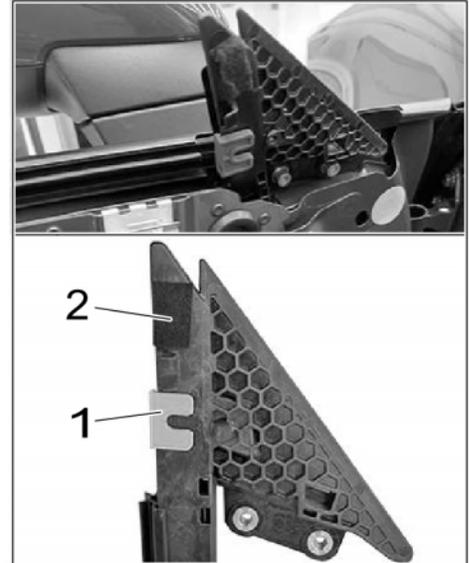

Position of spacer and felt strip

Concluding work

Work Procedure: 1 Install front door panel.
 For instructions, see:
 ⇒ *Workshop Manual '705919 Remove and install front door panel'*

Invoicing

For documentation and invoicing in the event of a warranty, state the work items required depending on the scope of work required and the specified PCSS encryption in the warranty claim:

APOS	Labor operation	I No.
57654922	Reworking rubber seal for door	
57654921	Reworking rubber seal for door	

PCSS encryption:

Location (FES5)	5765A	Mirror attachment point seal
Damage type (SA4)	1817	loose

References: ⇒ *Workshop Manual '705919 Remove and install front door panel'*

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2022 Porsche Cars North America, Inc.