

Reference	SSM75783
Models	Range Rover / L405 Range Rover Sport / L494
Title	INGENIUM I6 3.0L PETROL MHEV – DTC U0111-00 MIL Illuminated
Category	Electrical
Last modified	06-Jul-2022 00:00:00
Symptom	203000 Basic Electrical
Attachments	SSM Attachment Slide v2.pdf (SSM Attachment Slide v2.pdf)

Content**Issue:**

JLR is investigating customers reporting MIL illuminated. Upon investigation it's found that DTC U0111-00 Lost Communication with Battery Energy Control Module "A" - No sub type information logged in the Powertrain Control Module (PCM)

Cause:

Incorrect Battery Energy Control Module (BECM) harness routing causing tension on connector C4YB01D resulting in high resistance/open circuit.

Action:

1. Remove Right Load Space Trim Panel (TOPIX section 501-05)
2. Remove the original clipping feature on the MHEV Battery harness and replace with a suitable cable tie (200mm x 4.8mm) making sure the harness is routed correctly and not tight putting the harness under stress as per the attachment and check for connector damage and repair if required
3. Clear DTC's and retest vehicle.

Thank you in advance for your assistance with this matter

anBhdHRlcnM7MjAyMj0wNy0wNiQxNzo0MzooNy45NTJaOzEzNi4yMjYyNzluOD07