

| | |
|----------------------|---|
| Reference | SSM75800 |
| Models | Range Rover Sport / L494 |
| Title | Clicking noise from top of windshield while driving. |
| Category | Noise Vibration |
| Last modified | 22-Jul-2022 00:00:00 |
| Symptom | 702000 Other Noise Concerns |
| Attachments | Image 16.pdf (Image 16.pdf) Video 1.MOV (Video 1.MOV) Video 2.mov (Video 2.mov) |

ContentIssue:

JLR is investigating customers reporting clicking noises from the top of the windshield while driving. Please refer to attachments.

Cause:

Metal locating tab on body, used for manufacturing is in contact with the windshield.

Action:

Remove A pillar trims and sun visors (refer to TOPIx workshop manual section 501-05: Interior Trim and Ornamentation - Removal and Installation) to allow the headlining to be lowered enough to inspect for contact between the metal tab and windshield.

If the metal tab is in contact, then use a suitable tool to bend the tab away from the windshield to make a 4mm clearance. Care must be taken to ensure no damage is made to the windshield.

Thank you in advance for your assistance with this matter.

anBhdRfRtcnM7MjAyMl0wNy0yMlQxMT01NT01OS44NzFaOzEzNi4yMjYyNzluODQ7