

 HYUNDAI Technical Service Bulletin	GROUP CAMPAIGN	NUMBER 22-01-061H
	DATE JULY, 2022	MODEL(S) PALISADE (LX2)
SUBJECT: ECU/TCU UPDATE – DRIVABILITY LOGIC (SERVICE CAMPAIGN T8P)		

*** IMPORTANT**

***** Dealer Stock and Retail Vehicles Only *****

Dealers must perform this Service Campaign on all affected vehicles prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair.

Access the “Vehicle Information” screen via WEBDCS to identify open campaigns.

DESCRIPTION: This bulletin provides the procedure to update the ECU and TCU software logic to improve the drivability when decelerating to a stop.

APPLICABLE VEHICLES: Certain 2023MY Palisade (LX2)

GDS INFORMATION: System Selection: **Engine:**

Event #	Description
#874	LX2 PE 3.8 GDI DRIVABILITY IMPROVEMENT (ECU)

GDS INFORMATION: System Selection: **A/T**

Event #	Description
#875	LX2 PE 3.8 GDI DRIVABILITY IMPROVEMENT (TCU)

ECU ROM ID INFORMATION TABLE:

Model	Event	Drive	Part Number	ROM ID	
				Old	New
Palisade (LX2)	#874	ALL	39102-3LFN5	LPPNEM T3A	LPPNEM T3D
			39102-3LFN6	LPPNES T3A	LPPNES T3D

TCU ROM ID INFORMATION TABLE:

Model	Event	Drive	Part Number	ROM ID	
				Old	New
Palisade (LX2)	#875	2WD	95441-4GHJ0	SLX2G38NSA	SLX2G38NSB
		4WD	95441-4GHK0	SLXTG38NSA	SLXTG38NSB

WARRANTY INFORMATION:

Model	Op Code	Operation	Op Time	Causal Part	Nature Code	Cause Code
Palisade (LX2)	20D093R1	ECU + TCU UPGRADE	0.5 M/H	39102-3LFN5	I3T	ZZ3

NOTE 1: Submit claim on Campaign Claim Entry Screen.

NOTE 2: If a part is found in need of replacement while performing the Service Campaign and the affected part is still under warranty, submit a separate claim using the same repair order. If the affected part is out of warranty, submit a Prior Approval request for goodwill consideration prior to the repair.

SERVICE PROCEDURE:

NOTICE

You must initially perform GDS ECU and TCU Update in Auto Mode.

- If the ECU or TCU update starts but then fails in Auto Mode, disconnect the battery cables and touch the cables together for one minute. Reconnect the battery cables, attach a battery charger and perform the update in Manual Mode to recover.
- Refer to the General Instructions found in TSB 15-GI-001 (GDS Mobile).

After the ECU and TCU Updates are completed, check for Diagnostic Trouble Codes and erase any DTC.

MANUAL UPDATE: If the ECU or TCU Update starts but then fails in Auto Mode, perform the update in Manual Mode to recover.

Model	Menu		Password
Palisade (LX2)	#874	LX2 PE 3.8GDI 8AT 39102-3LFN5 (ECU)	2305
	#874	LX2 PE 3.8GDI 8AT 39102-3LFN6 (ECU)	2306
	#875	LX2 PE 3.8GDI 8AT 2WD 95441-4GHJ0 (TCU)	4414
	#875	LX2 PE 3.8GDI 8AT 4WD 95441-4GHK0 (TCU)	4144