

Bulletin No.: PIP5861
Published date: 07/21/2022

Preliminary Information

PIP5861 Misfire Due To Collapsed Lifter

Models

Brand:	Model:	Model Years:	VIN:		Engine	Transmissions
			from	to	Engine:	Transmissions:
Cadillac	Escalade	2022	October 9, 2021	December 18, 2021	6.2 L87	All
Chevrolet	Silverado 1500	2022	October 9, 2021	December 18, 2021	5.3 L84 6.2 L87	All
Chevrolet	Suburban	2022	October 9, 2021	December 18, 2021	5.3 L84 6.2 L87	All
Chevrolet	Tahoe	2022	October 9, 2021	December 18, 2021	5.3 L84 6.2 L87	All
GMC	Sierra 1500	2022	October 9, 2021	December 18, 2021	5.3 L84 6.2 L87	All
GMC	Yukon	2022	October 9, 2021	December 18, 2021	5.3 L84 6.2 L87	All
Holden / GMSV	Silverado 1500 (4WD Only)	2022	October 9, 2021	December 18, 2021	6.2 L87	All

Involved Region or Country	North America, Middle East, Australia and New Zealand
Condition	The vehicle may come in with a P0300 - P0308 set with a bent push rod that leads to a Collapsed lifter or a lifter that has come apart.
Cause	Internal lifter concern.

Correction:

If service information leads to a collapsed lifter and/or lifter has come apart including a bent pushrod it will be necessary to follow the replacement guideline below.

- If vehicle has under 16,000 miles (25,750km) and is within the breakpoint window it will be necessary to replace all lifters and guides on both banks.
- If vehicle has over 16,000 miles (25,750km) and is within the breakpoint window it will be necessary to replace the lifters and guides on the effected bank only not both.

Breakpoint for the models effected October 9, 2021 to December 18, 2021

When replacing the lifter and guide please indicated which lifter has failed by marking its location on the guide for inspection (please do not cover the date code). The parts will be requested back.

Note: It is not necessary to replace the oil control solenoid for this failure mode.

If the vehicle does not fall into the breakpoint window, please follow the latest version of 19-NA-218.

Warranty Information

For this repair use the published labor time as called out in SI Labor Time Guide.

<u>Version History</u>

Version	1
Modified	07/21/2022 - Created on.

















GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.