

WLN2 Workshop campaign – Replacing electric passenger compartment heater

WLN2 Workshop campaign - Replacing electric passenger compartment heater

ID Number	WLN2
Models	Taycan (Y1A)
Model Years	2020-2021
VIN list	Attached
Number of Affected VINs	57
Issue Description	<p>An electric passenger compartment heater may have been installed on the affected vehicles for which the soldering of a circuit board does not meet the required specifications.</p> <p>This can result in function restriction of the electric passenger compartment heater in some cases. As a result, temperature control of the passenger compartment air conditioning and the high-voltage battery is impaired.</p> <p>To prevent this, the electric passenger compartment heater must be replaced on the affected vehicles.</p>
What Dealers should do	<p>The electric passenger compartment heater must be replaced on the affected vehicles.</p> <p>As of the time of this posting, the repair is immediately available.</p> <p>The heater part # PAD963507 must be ordered via PPL with PRMS Parts ticket for release. Please include the PPL Order# in the PRMS ticket.</p>
TI Number	No. 219-20

Required parts and materials

Parts required:

Part No.	Designation	Quantity/vehicle	Parts return*
PAD963507	Electric passenger compartment heater	1 ea.	No
N 10737001	Hexagon nut, M6	4 ea.	No
Required materials (only if needed):			
Part No.	Designation	Quantity/vehicle	
00004330516	Coolant additive, 20-litre container	As many as required (Max. 1 litre required per vehicle)	

* The parts must be stored until such time as the related warranty or campaign claim has been credited. If a barcode is generated with the credit note, the affected part must be sent to Porsche AG as usual. If no barcode is generated with the credit note, the part can go directly into the genuine remanufactured parts process or be scrapped.

Warranty processing

Validity:

This workshop campaign will be carried out up to January 7th, 2026 and will be closed on that date.

Please note that warranty claims can only be processed before this date.

Scope 1:

Damage Code	WLN2 66 000
Repair Code	2
Working time	590 TU

Please enter the campaign that was carried out in the Warranty and Maintenance booklet for the vehicle.

Porsche Mobility

If requested, the mobility of the affected customer can be guaranteed by offering a suitable replacement vehicle.

Please invoice this additional service with the campaign scope via WWS.