

MAS003169 (MSC 22-28)

Campaign 516

FROM: Maserati TSO

TO: Maserati Network



MASTERS OF CARE

Service Campaign 516

M15X-M161 V6 MY21-22: ECM Sw Update



DATE: JULY 7 2022

Certain Maserati Ghibli (M157), Levante (M161) and Quattroporte(M156) MY21-22 equipped with V6 engines listed in MODISCS+ are involved in a Service Campaign concerning the ECM Software Update to improve the performance of the engine calibration.

Only for MY22 vehicles, this new Software will improve the detection strategy of the DMTL system, avoiding the improper activation of the **DTC P043E** that could cause warning light or messages on the cluster. In addition, this update will also correct the crankcase issue for MY21-22 vehicles.

Please read and review this bulletin first before starting the procedure. If you have any questions, contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk. (Maseratitechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure

1. Always check in ModisCS+ to see if the vehicle is involved in this campaign and if the campaign has not been previously performed.
2. Before proceeding, please ensure that the Engine is OFF.
3. Connect the MD EVO to the VCI2 using the USB cable.
4. Connect the VCI2 to the vehicle.
5. Key ON Engine OFF (KOEO) check battery voltage and ensure it is 12V or above.
6. With the MD EVO select **ECM ► ECU Programming** and follow the prompts.

The Sw Below (or further) must be installed

Market	MY	Model	Engine	F132 New
NORTH AMERICA	21	M15X	430 AWD	673013893
			430 RWD	673013894
			350	673013895
		M161	430	673013896
			350	673013897
			22	M15X
	430 RWD	670296485		
	350	670296486		
	M161	430		670296514
		350	670296515	

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Campaign Number	516
Warranty Code	23
Fault Code	063
Component Code	1.90.001
Operation Code	1.90.001.A (0,25)