

MAS003188 (MSC 22-31)

Campaign 522

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Service Campaign 522 MC20 - DCTM Software Update



DATE: July 13 2022

Certain Maserati MC20 (M240) vehicles listed in ModisCS+ are involved in a Service Campaign concerning the DCTM (Dual Clutch Transmission Module) software release to update the diagnosis calibration.

In certain conditions, a potential stuck-on gear selection could be noticed by the customer. Consequently, the Engine and transmission MIL (Malfunction Indicator Light) could illuminate on the IPC (Instrument Panel Cluster).

Please read and review this bulletin first before starting the procedure.
If you have any questions, contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk. (MaseratiTechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati North America Inc.
Aftersales Dept.

Technical Procedure

1. Always check in ModisCS+ to see if the vehicle is involved in this campaign and if the campaign has not been previously performed.
2. Before proceeding, please ensure that the Engine is OFF.
3. Connect the MD EVO to the VCI2 using the USB cable.
4. Connect the VCI2 to the vehicle.
5. Key ON Engine OFF (KOEO) check battery voltage and ensure it is 12V or above.
6. With MD-EVO perform **DCTM ► ECU Programming** and follow the prompts.
7. Procedure is completed.

The Sw Below (or further) must be installed

Type	F188 New
m-LSD	670296739
e-LSD MY21	673014262
e-LSD MY22	670296738

Entering a Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Campaign Number	522
Warranty Code	23
Fault Code	063
Component Code	3.10.147
Operation Code	3.10.147.A (0,15h)