



Dealer Principal	General Manager	Sales Manager	Service Manager	Parts Manager	Marketing	Finance
Date: June 15, 2022		Source:			Replaces: A 04 2022 04 U	
Bulletin #: A 06 2022 03 U		Name:			Supersedes: n/a	
		Title:			Group: n/a	
		Phone #:				
		Email:				

Aftersales Bulletin

00 51 44 05 00 – Service Action Comfort Entry Access Deactivation

This bulletin A 06 2022 03 U replaces bulletin # A 04 2022 04 U dated April 14th, 2022.

PERFORM THE PROCEDURE OUTLINED IN THIS SERVICE INFORMATION ON ALL AFFECTED VEHICLES THE NEXT TIME THEY ARE IN THE SHOP FOR MAINTENANCE OR REPAIRS AND PRIOR TO RETAIL DELIVERY.

What's New: Highlighted in Yellow

Situation: ETA for solution is now mid to late summer

Procedure: Risk of damage notes

Warranty: Labor code/FRU update

Affected Vehicles

This Service Action affects Rolls-Royce Phantom (RR11/12), Ghost (RR21/22) and Cullinan (RR31), models produced from January 28th, 2022, to March 31st, 2022. The affected vehicles are fitted with Comfort Entry Access feature (option code 322).

Situation

The Comfort Entry Access feature in the affected vehicles have been identified as having a potential issue which does not allow operation as intended. Therefore, vehicles that have been identified within this campaign will need to have the Comfort Entry Access system deactivated.

Important Note: Inform the customer that the feature has been deactivated, and the solution to reactivate the Comfort Entry Access system is **now expected in mid to late summer 2022.**

Information

A technical campaign has been launched to ensure that all affected vehicles have the Comfort Entry Access system deactivated until the solution can be implemented. Dealer personnel should use Integrated Service Processes Application (ISPA), S-Gate “Campaigns for Vehicle” to check whether a vehicle requires this technical campaign or via Aftersales Information Research (AIR). Please see bulletin “A10 2016 Recall / Technical Campaign Check” for details.

Procedure

Published date June 16, 2022

The Comfort Entry Access door handles must be temporarily deactivated by removing the signal wire from the Body Domain Controller (BDC).

Refer to the repair instructions outlined below.

1. Access the Body Domain Controller by removing the front right A-pillar side panel, please refer to REP: 51 43 075 Remove and install side trim panel, footwell, on A-pillar right .



Risk of damage! Protect surfaces and pay extra care when working with high-quality interior materials.





Risk of damage! Pay extra care when fitting Illuminated Treadplates to ensure that the wire/ribbon does not become damaged.




2. Disconnect Plug connector A258*9B from the BDC control unit.

Published date June 16, 2022

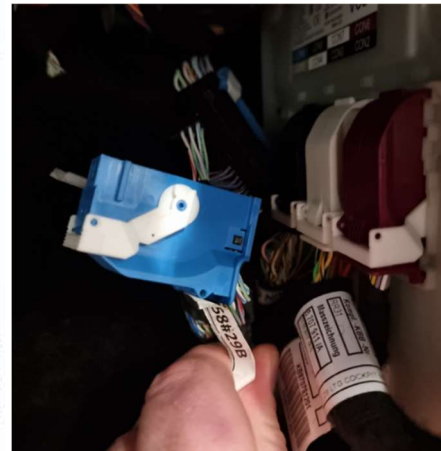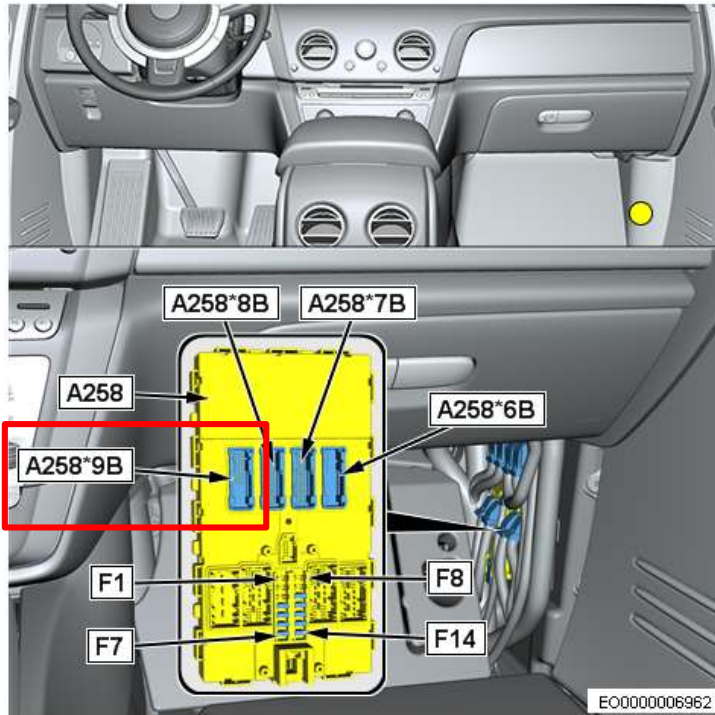


3. Remove socket housing protective cap by pressing locking tabs (1) in an upwards direction, and sliding the protective housing (2), and slide contact carrier (3) outwards.

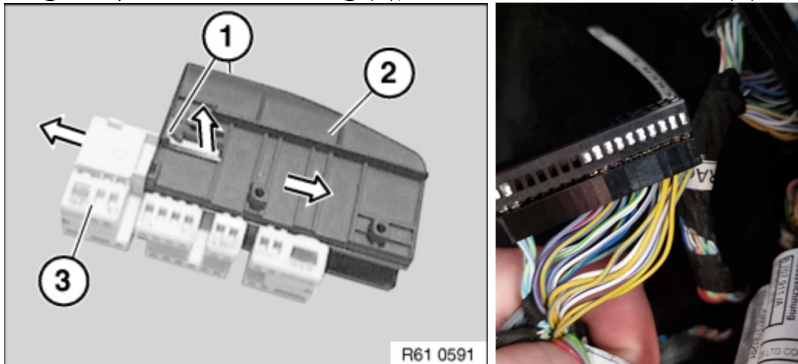


4. Remove the following pin contacts:
 - a. 33 (GE) – yellow
 - b. 34 (GE/BR) – yellow & brown
 - c. 35 (GE/BL) – yellow & blue
 - d. 36 (GE/GR) – yellow & grey


Published date June 16, 2022

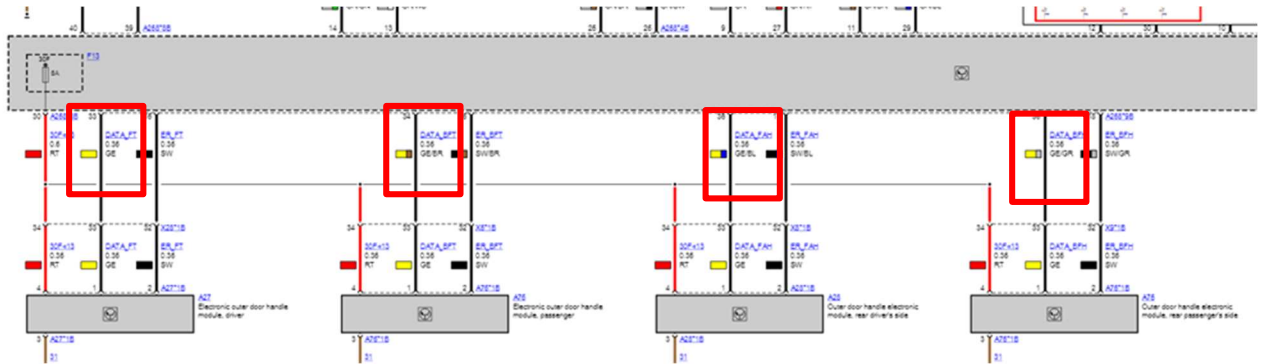

Note! Connector shown below in the next 2 pictures are for illustration purposes only. Hold down retaining hook (1) of pin contact in opening of carrier with a small screwdriver. Gently pull wire with pin contact in direction of arrow as far as secondary lock (2).

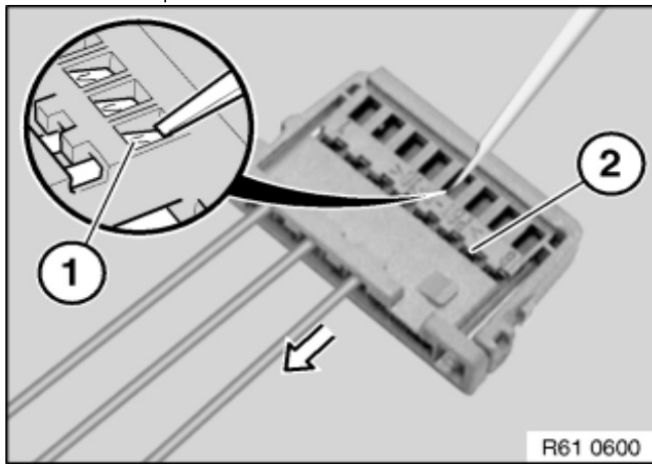


Hold down retaining hook in secondary lock (1) again and gently pull wire with pin contact (2) completely out of carrier (3).

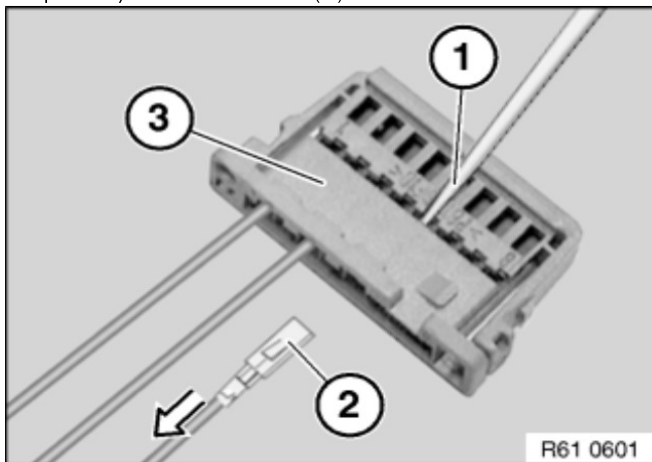

Published date June 16, 2022

5. Fit the removed pins into 4 pol connector 61 13 2 359 994, or alternative MQS connectors. Pictures are for reference only; the color of the connector may be different.

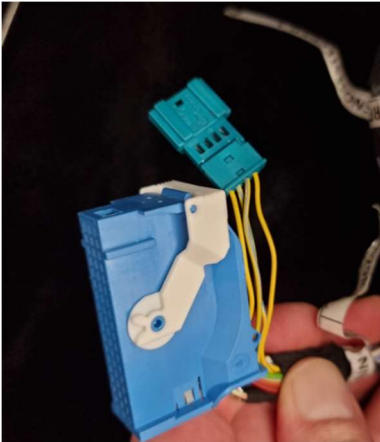

6. Tape the newly fitted plug connector onto the existing wiring harness and ensure it is secure in such a way that it will not lead to rattles when the vehicle is in motion.
7. Reconnect plug connector A258*9B to the BDC control unit.
8. Connect the vehicle to ISTA and delete/clear the fault codes set due to A258*9B being disconnected.
9. Verify that the Comfort Entry door handles are no longer functioning.
10. Re-assemble the vehicle.

Parts Information

Description	Part Number	Quantity
Plug Housing (4 pol connector) *	61 13 2 359 994	1

Only order connector quantities required to urgently release vehicles until new parts are available for order from week commencing 18th of April 2022.

*You may use a different type of available MQS connectors that ensure secure fit of removed pins, for example, 2 x 2-pol connectors for RR11/12/21/22/31 or 1 x 2-pol connector for RR5/6.

Warranty Information

Claims are subject to current Warranty terms.

Defect Code: 00 51 44 05 00

Please use one of the four labor code sections for the relevant vehicle model type.

Rolls-Royce Phantom (RR11/12).

Published date June 16, 2022

Labor Code	Description	Labor	Notes
51 43 075	Remove and install/replace side trim panel, footwell, on A-pillar, right	4 FRU	Main work
00 99 000	De-pinning and fitting connector	2 FRU	Main work
00 00 556	Performing vehicle test	3 FRU	Plus Position

Rolls-Royce Ghost (RR21/22).

Labor Code	Description	Labor	Notes
51 43 075	Remove and install/replace side trim panel, footwell, on A-pillar, right	6 FRU	Main work
00 99 000	De-pinning and fitting connector	2 FRU	Main work
00 00 556	Performing vehicle test	3 FRU	Plus Position

Rolls-Royce Cullinan (RR31).

Labor Code	Description	Labor	Notes
51 43 075	Remove and install/replace side trim panel, footwell, on A-pillar, right	5 FRU	Main work
00 99 000	De-pinning and fitting connector	2 FRU	Main work
00 00 556	Performing vehicle test	3 FRU	Plus Position

Contact

If you have further questions, please contact your Regional Aftersales Manager (RAM).