



Technical Service Bulletin

01 MIL on, DTCs P017100, P217700, P21F400, P21F800, P017400, P21F600, and/or P217900 may be stored in the ECM

01 22 26 2055224/3 August 23, 2022. Supersedes Technical Service Bulletin Group 01 number 20-68 dated June 18, 2020, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
R8 V10	2019 – 2022	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised header (Added model year)
2	06/18/2020	Revised title Revised header (Added model year) Revised <i>Service</i> (Updated information)
1	07/11/2019	Initial publication

Customer states:

- Exhaust emissions warning lamp is on.

Workshop findings:

- The vehicle has less than 700 miles on the odometer.

One or more of the following DTCs are logged in the engine control module (ECM), J623 (address word 0001) or the engine control module 2 (ECM2), J624 (address 0011):



Technical Service Bulletin

- **DTC P017100** (bank 1, fuel measuring system too lean).
- **DTC P217700** (bank 1, fuel measuring system too lean from idle speed).
- **DTC P21F400** (fuel measuring system 2, bank 1 system too lean from idle speed).
- **DTC P21F800** (fuel measuring system 2, bank 1 system too lean at idle speed).
- **DTC P017400** (bank 2, fuel measuring system too lean).
- **DTC P21F600** (fuel measuring system 2, bank 2 system too lean from idle speed).
- **DTC P217900** (bank 2, fuel measuring system too lean from idle speed).

Technical Background

Not applicable.

Production Solution

Not applicable.

Service

Replace the lambda probe before catalyst of the affected cylinder bank according to the DTC. Also, check the respective catalyst with a borescope for damage.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.
--------------------	--



Technical Service Bulletin

	<ul style="list-style-type: none">If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	2469		
Damage Code:	0010		
Labor Operations:	Front heated oxygen sensor remove + reinstall	2469 1973	See SRT
	Air cleaner one side	2425 1903 (Coupe) Or 2425 1904 (Spyder)	See SRT
	Check catalyst	2673 0199	10 TU
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 10 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	0121 0004	10 TU
Claim Comment:	As per TSB 2055224/3		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
See ETKA (VIN Specific)	Lambda probe (based on DTC)	01

Additional Information

All parts and service references provided in this TSB (**2055224**) are subject to change and/or removal. ©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.