


2022-08-29

[illegible]

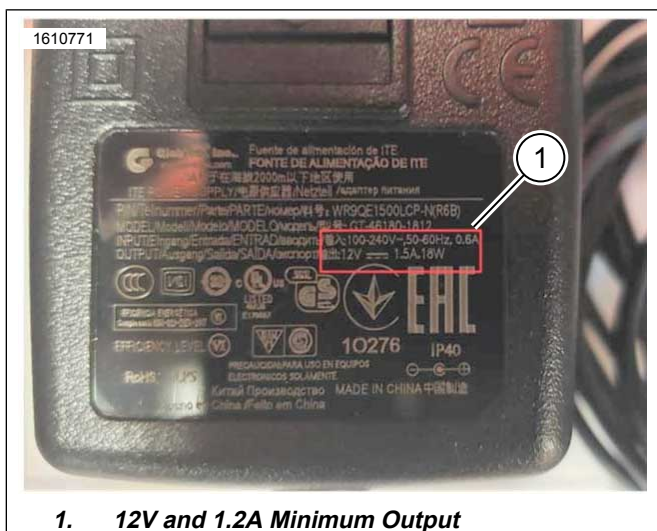

1. 12V and 1.2A Minimum Output

Figure 2. 12V and 1.2A Output

- The vehicle battery should be fully charged prior doing the software update.
- Have a battery tender connected to the battery while performing software update.

Table 4. Software Version

Current Version	Update Version
5.0.0.2	6.4.1.2

Hand Control Module (HCM) Reflash Sequence

NOTE

Do not charge battery through vehicle's tender lead.

1. Connect battery charger/tender directly to vehicle battery.
2. Connect TL-3 to vehicle.
3. Connect external power to TL-3 using appropriate power supply providing at least. See Required Dealer Action Note.
4. Place vehicle in accessory mode.
5. Press and hold trip button for 5 s.
6. Open DT II program and establish communication with vehicle.
7. Proceed to reflash HCM and follow on-screen directions.
8. **After reflash of HCM is complete, check for and clear any DTC.**

Credit Procedure

NOTE

Enter bulletin number into comment section of claim.

Submit a warranty claim per Table 5 for updating HCM.

Table 5.

ITEM	DATA
Claim Type	PRD/MC/DEM Pre-Delivery/Standard claim
Problem Part Number	71500552A or 71500579A
Quantity	Leave blank
Primary Labor Code ⁽¹⁾	7836
Time	0.2 h
Customer Concern Code	9203
Condition Code	7836
(1) Download may be required	