

Glass panel of Panoramic Sliding Sunroof cannot be actuated with Overhead Control Panel slider

Topic number	LI77.21-P-075160
Version	1
Function group	77.21 - Panoramic roof
Date	8/11/22
Validity	Model series 206 with code 413 (Panoramic roof)
Reason for change	Software remedy available

Complaint

The glass panel of the Panoramic Sliding Sunroof may not open/close when actuated via the slider of the overhead control panel.

Note: The sunroof does actuate via XENTRY Diagnosis and other overhead control panel functions are not affected.

Cause

Previously released Panoramic Sliding Roof control unit (A98) software

Remedy

Perform initial start-up of Panoramic Sliding Roof control unit (A98)

WIS-References		
Document number	Title	Note
AD00.00-P-2000-06FR	Connect/disconnect diagnostic device	-

Symptoms
Body > Roof system > Tilting/sliding sunroof system > Does not close

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 223 902 91 24			Software	1		X

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
540991	PROGRAM AND CODE CONTROL UNIT (AFTER QUICK TEST)	002 AW	8201DT8	

XENTRY TIPS

541011	Perform quick test	003 AW	8201DT8	
776901	Standardize panoramic sliding sunroof and teach in automatic reversing function (after quick test)	001 AW	8201DT8	