



Service Bulletin


Bulletin No.: 22-NA-084

Date: August, 2022

INFORMATION

Subject: Information on Unable to Open Folding Top, DTC B19E1 sym64 Possibly Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Corvette	2020	2023	—	—	All	All

Involved Region or Country	North America, Europe, Middle East, Japan, Israel, Palestine, Thailand, Australia/New Zealand
Condition	Some customers may comment that the folding top will not open. Technicians may find DTC B19E1 sym64 set.
Cause	<div style="text-align: right; margin-bottom: 5px;">6039905</div>  <p>The cause of the condition may be that the body side frame access hole plug may not have been seated properly. This may lead to the plug interfering with B373 Folding Top Side Rail - Roof Panels Stowed Sensor.</p> <p>Note: The body side frame access hole plug must be fully seated whenever the plug is removed.</p>
Correction	<ol style="list-style-type: none"> 1. First gain access to the body side frame access hole plug. Refer to <i>Opening the Folding Top Stowage Compartment Lid — Engine Access</i> section within <i>Folding Top and Folding Top Stowage Compartment Lid Operation</i> in the Service Manual. 2. Inspect the body side frame access hole plug to assure it is fully seated. <p>Note: The customer should be informed to ensure the access plug is secured, and fully seated, before driving the vehicle whenever the oil or coolant is checked. Please share this information with the customer, including a copy of this bulletin.</p>

Parts Information

No parts are required for this repair.

Version	2
Modified	Released April 14, 2022 Revised August 24, 2022 – Added the 2023 Model Year.

