

Technical Information

Service 153/22 ENU


4

WNC5

WNC5 - Check Universal Joint on the Intermediate Steering Shaft and Exchange Intermediate Steering Shaft if Necessary (**Stop Delivery** / Workshop Campaign)

Model Series:	Macan (95B)
Model Year:	As of 2021 up to 2023
Concerns:	Intermediate steering shaft
Information:	There is a possibility that the universal joint on the intermediate steering shaft was damaged during the production process on the affected vehicles.
	If this is the case, there may be clearly perceptible play and possible noise in the steering.
Action required:	Check bolts on universal joint of intermediate steering shaft and exchange intermediate steering shaft depending on the outcome of the check.
Affected Vehicles:	Only the vehicles assigned to the campaign (see also PCSS Vehicle Information).
Check universal joint on the intermediate steering shaft and exchange intermediate steering shaft if necessary	

- Work Procedure: 1 Raise the vehicle on a lifting platform. \Rightarrow Workshop Manual '4X00IN Lift vehicle'
 - 2 Check \Rightarrow *Installation position of universal joint* -1 both bolts on the universal joint. Change the steering angle on the wheel in order to check all bolts.

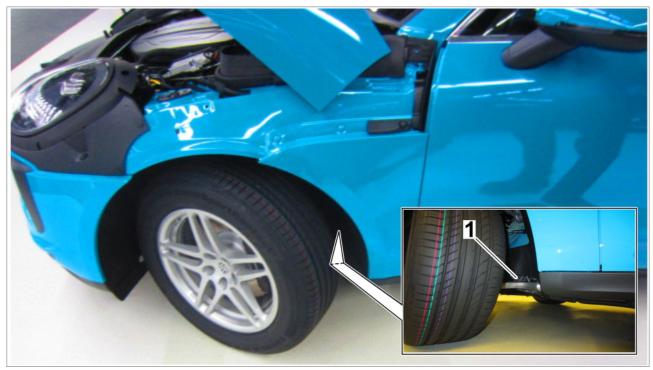


Installation position of universal joint

Both **bolts** \Rightarrow Checking universal joint -1- are within the visible impression:

– End of action –

Continue with Step 3.

- You can feel and see one or both bolts sticking out of the universal joint: The universal joint is damaged and the intermediate steering shaft must be replaced. To do so, proceed with ⇒ Workshop Manual '482819 Removing and installing intermediate steering shafts'. The incurred labor costs and the additional cost of parts required must then be invoiced using a reimbursement claim for the original campaign claim for this campaign. In this case, photographic documentation is absolutely essential and must be attached to the campaign claim.
- 3 Remove vehicle from the lifting platform ⇒ Workshop Manual '4X00IN Lifting the vehicle'.

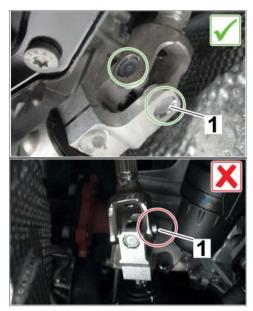

Checking universal joint


4 Enter the campaign in the Warranty and Maintenance booklet.

AfterSales

Technical Information

Warranty processing

Scope 1:

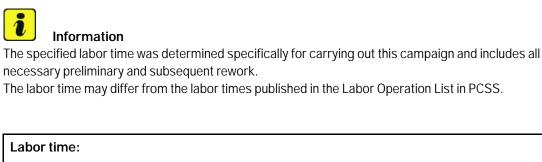

Check universal joint on the intermediate steering shaft Lifting and lowering vehicle on a lifting platform Includes:

Labor time: 30 TU

 \Rightarrow Damage code WNC5 066 000 1



Information

If the intermediate steering shaft is damaged and has to be replaced, the incurred labor costs and the additional cost of parts required over and above this must then be invoiced using a reimbursement claim for the original campaign claim for this campaign. In this case, photographic documentation is absolutely essential and must be attached to the campaign claim.

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2022 Porsche Cars North America, Inc.

