



Technical Service Bulletin

SUBJECT:		No: TSB-22-51-002	
REAR (AIR) SPOILER CRACK		DATE: August 2022	
		MODEL: See Below	
CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY PROCESSOR	<input type="checkbox"/> SALES MANAGER

PURPOSE

A customer may find a crack on the Rear Spoiler, also known as Air Spoiler. Multiple factors such as heavy pad compression on the spoiler bolt retainer during shipping and vast temperature fluctuations causing shrinkage and expansion may be the cause.

This TSB instructs the dealers to replace the Air Spoiler, RR on a customer complaint basis.




AFFECTED VEHICLES

2021-2022 Mirage
2021-2022 Mirage G4

PROCEDURE

Refer to the Service Manual as needed:

Mirage > Group 51 > Exterior > Liftgate Spoiler and Group 52A > Interior > Trims
Mirage G4 > Group 51 > Exterior > Rear Air Spoiler:

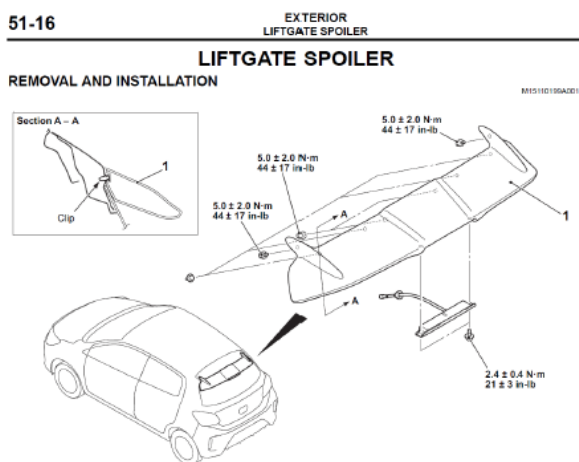

Copyright 2022, Mitsubishi Motors North America, Inc.

The information contained in this bulletin is subject to change. For the latest version of this document, go to the Mitsubishi Dealer Link, MEDIC, or the Mitsubishi Service Information website (www.mitsubishitechinfo.com).

PROCEDURE (Continued)

1. Open the trunk lid and remove the bolts for the Air Spoiler.



2. Insert tool between the Air Spoiler and trunk lid, then gently pry to remove.




PROCEDURE (Continued)

3. Any damaged or missing grommets must be replaced. If the grommets are undamaged, replacement is not necessary. Please use a tool to gently pry the grommet when removing.



4. Thoroughly clean the trunk lid before attaching the new part.

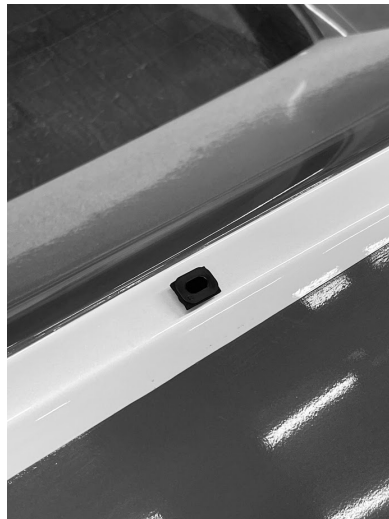

PROCEDURE (Continued)

5. Notice the new part (bottom piece) now has a strip added. Bolt the new Air Spoiler part onto the trunk lid.



PARTS

Part Name	Part No.		Date	VIN cut off
	<New>	<Old>		
AIR SPOILER, RR	96032W001P	6515A491XA	Dec-01-2021	ML32FUFJ0NHF03475
	96032W008P	6515A491WB	Dec-01-2021	ML32FUFJ2NHF03509
	96032W007P	6515A491BA	Dec-02-2021	ML32FUFJ9NHF03569
	96032W005P	6515A491RA	Dec-02-2021	ML32FUFJ0NHF03587
	96032W003P	6515A491HA	Dec-02-2021	ML32FUFJXNHF03581
	96032W004P	6515A491HB	Dec-02-2021	ML32FUFJ1NHF03582
	96032W006P	6515A491RB	Dec-07-2021	ML32FUFJ6NHF03898
	96032W002P	6515A491WA	All vehicles produced after Jan 2022	

WARRANTY INFORMATION

This bulletin is supplied as technical information only and is not an authorization to repair. If an affected vehicle is reported with the described condition, diagnose the condition, repair as described in this bulletin and submit a normal warranty claim using the information below.

NOTE: Submit a claim using the PRIMARY PART NUMBER which will be the applicable **Air Spoiler part number**. Claims submitted using the incorrect primary part may be investigated and require correction.

OPERATION	NATURE CODE	CAUSE CODE	LABOR OPERATION	TIME ALLOWANCE
Replace Air Spoiler, RR	99D	990	515025GN	0.6 HOURS

Warranty Coverage: 5/60 Basic Coverage (Canada: 5/100)