


Howl Noise From the Front Lower Control Arms

Service

Category Suspension

Section Front Suspension Market USA and Mexico

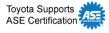

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION	
2022	Tundra		

Introduction

Some 2022 model year Tundra vehicles may exhibit a howling or whistling noise from the front lower control arms at speeds of 30 - 50 mph (50 - 80 km/h). Follow the Repair Procedure in this bulletin to address this condition.

TOYOTA T-SB-0068-22 August 15, 2022 Page 2 of 5

Howl Noise From the Front Lower Control Arms

Table of Contents

•	Production Change Information	3
	Warranty Information	
	For USA Market	
	For Mexico Market	
	Parts Information (USA and Mexico)	
	Repair Procedure	

TOYOTA T-SB-0068-22 August 15, 2022 Page 3 of 5

Howl Noise From the Front Lower Control Arms

Production Change Information

This bulletin applies to 2022 model year Tundra vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PLANT	DRIVETRAIN	PRODUCTION CHANGE EFFECTIVE VIN
			5TFJA5AA#NX008571
			5TFLA5AA#NX008571
			5TFKB5AA#NX008571
			5TFJA5AB#NX008571
			5TFKB5AB#NX008571
			5TFLA5AB#NX008571
			5TFMA5AB#NX008571
		2WD	5TFNA5AB#NX008571
			5TFJA5BC#NX001645
			5TFLA5BC#NX001645
			5TFMA5BC#NX001645
			5TFNA5BC#NX001645
			5TFLA5CD#NX001211
Tundra	TNANAT∨		5TFKB5CD#NX001211
Tunura	TMMTX		5TFJA5DA#NX027391
		4WD	5TFLA5DA#NX027391
			5TFKB5DA#NX027391
			5TFJA5DB#NX027391
			5TFKB5DB#NX027391
			5TFLA5DB#NX027391
			5TFMA5DB#NX027391
			5TFNA5DB#NX027391
			5TFJA5EC#NX005679
			5TFLA5EC#NX005679
			5TFNA5EC#NX005679
			5TFMA5EC#NX005679
			5TFKB5GD#NX001460
			5TFLA5GD#NX001460

TOYOTA T-SB-0068-22 August 15, 2022 Page 4 of 5

Howl Noise From the Front Lower Control Arms

Warranty Information

For USA Market

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
SU1921	Install Hole Plugs in Left and Right Front Lower Control Arms	0.5	48068-0C011	91	99

APPLICABLE WARRANTY (USA)

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

For Mexico Market

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
SU1921	Install Hole Plugs in Left and Right Front Lower Control Arms	0.5	48068-0C011	91	99

APPLICABLE WARRANTY (MEXICO)

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 60,000 kilometers, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Parts Information (USA and Mexico)

PART NUMBER		PART NAME	QTY
	90950-A1021	Plug, Hole	4

TOYOTA T-SB-0068-22 August 15, 2022 Page 5 of 5

Howl Noise From the Front Lower Control Arms

Repair Procedure

1. Confirm the condition exists.

Does the vehicle exhibit a howling or whistling noise while driving at speeds of 30 - 50 mph (50 - 80 km/h)?

- YES Continue to step 2.
- NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- 2. Place painter's tape (or equivalent) over the two holes on both the left and right front lower control arms, as shown.
- 3. Test-drive the vehicle again to confirm the condition.

Has the howling or whistling noise while driving at speeds of 30 – 50 mph (50 – 80 km/h) been eliminated?

- YES Continue to step 4.
- NO This bulletin does NOT apply.
 Continue diagnosis using the applicable Repair Manual.
- 4. Remove the tape used in step 2.
- 5. Install the hole plugs in the holes of each front lower control arm by pressing firmly, by hand, on the center of the plug to ensure the plug is fully seated.

NOTICE

Do NOT use glue or lubrication during installation.

6. Test-drive the vehicle at speeds of 30 – 50 mph (50 – 80 km/h) to confirm the condition is no longer present.

Figure 1. Front Lower Control Arm



1 Apply Tape Here

Figure 2. Front Lower Control Arm



1 Place Hole Plug Here