

---

## **SSM 51078 2020-2022 F-Super Duty - 6.2L/7.3L - MIL On With DTC P0339 And/Or Runs Rough**

---

Some 2020-2022 F-Super Duty vehicles equipped with a 6.2L or 7.3L gas engine may exhibit an illuminated malfunction indicator lamp (MIL) with diagnostic trouble code (DTC) P0339 stored in the powertrain control module (PCM) or the vehicle may exhibit a runs rough concern with no DTCs. This may be due the crankshaft position (CKP) sensor. If pinpoint test JD in the Powertrain Control/Emissions Diagnosis (PC/ED) Manual or Workshop Manual (WSM), Section 303-14 leads to CKP sensor replacement, use service part LC3Z-6C315-C. For claiming, use causal part 6C315 and labor operation 12650D57D in the Service Labor Time Standards (SLTS) Manual.