



STAR ONLINE PUBLICATION




Case Number: S2208000082

Release Date: March 2022

Symptom/Vehicle Issue: Service 4WD Message Is Displayed In The Instrument Cluster

Discussion: The message to service 4WD is displayed in the cluster. Upon scanning the vehicle for DTC's you will find a C141C. This may be caused by Terminal Push Out (TPO) of the T528 (Rear Locker Control Return)YE/GY circuit at the D74A connector.

Diagnosis: Disconnect and inspect the D74A connector on the rear differential axle locker. Inspect for terminal push out.

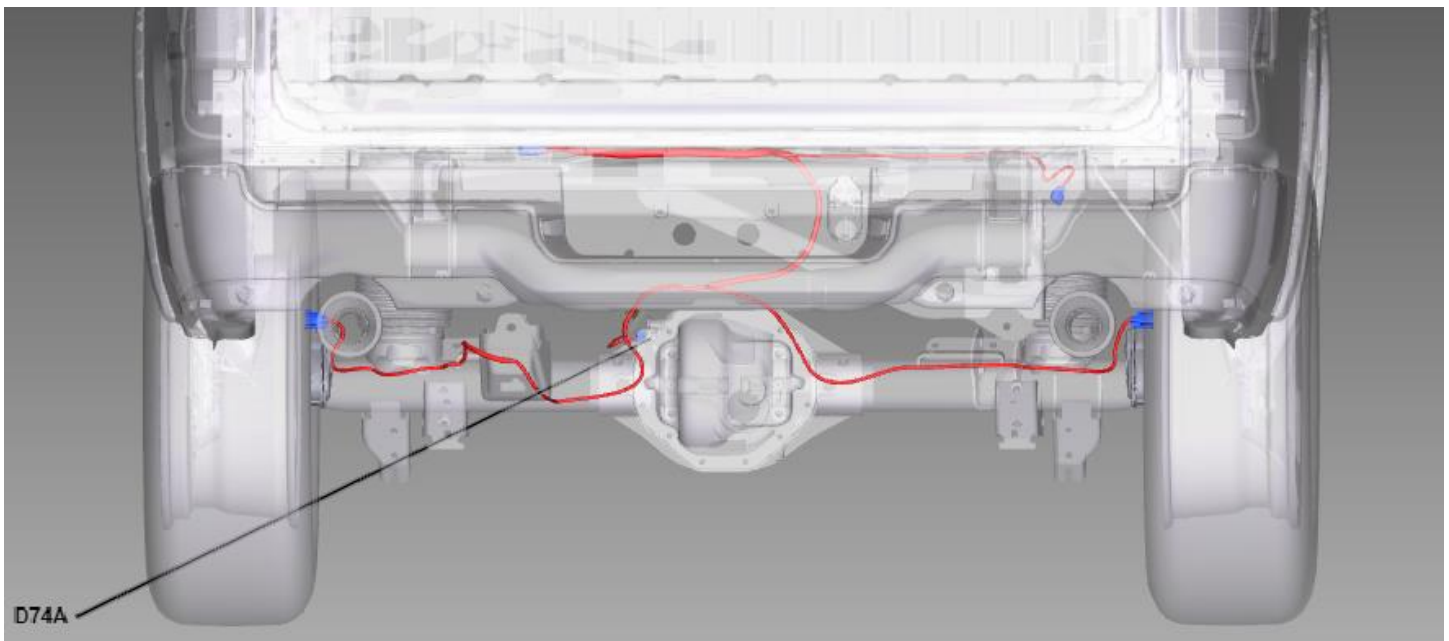

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found



STAR ONLINE PUBLICATION



Repair Procedure: If a pushed out terminal is found. Verify the terminal locking tab is intact. If an issue is found with the connector housing, replace the connector. Otherwise, re insert the terminal and confirm it is fully locked and engaged.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found