



## STAR ONLINE PUBLICATION



**Case Number:** S1908000159 REV. A

**Release Date:** March 2022

**Symptom/Vehicle Issue:** MIL Lamp On, DTC P0330 Knock Sensor 2 Circuit

**Customer Complaint /Technician Observation:** Owner complains of an Intermittent MIL lamp on. Technician observed DTC P0330 Knock Sensor 2 Circuit, stored or active.

**Discussion:** Inspect the harness routing at the rear motor at the rear of the head / transmission bell housing location for any areas of pinching or contact. Inspect the harness routing for any contact areas between the transmission bellhousing and engine block. Repair any suspect harness damage and isolate the harness as needed from contact areas. No parts required Fig 1, 2.

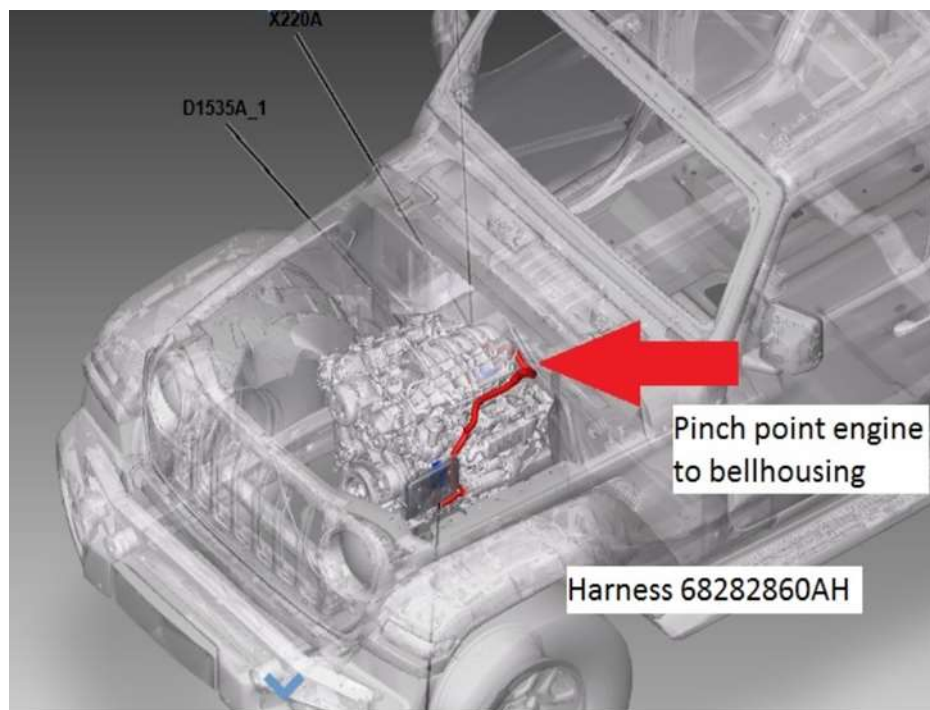


Fig 1

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**



## STAR ONLINE PUBLICATION



### Wiring Diagram - IGNITION SYSTEM - 2.0L

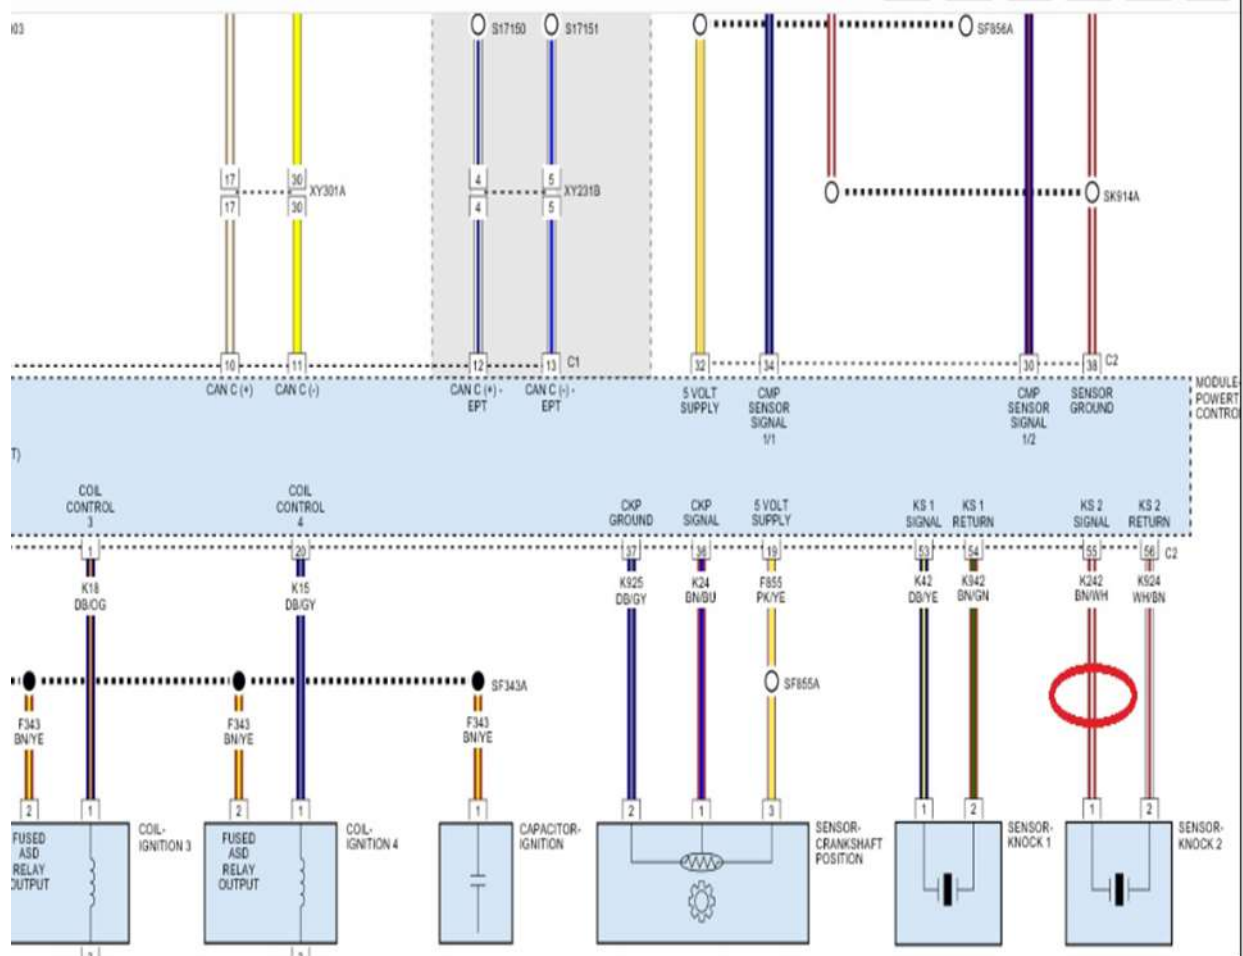


Fig 2 affected circuit in this case.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**