



STAR ONLINE PUBLICATION




Case Number: S2208000132

Release Date: June 2022

Symptom/Vehicle Issue: Multiple Cluster Warning Lamps On, Malfunction Indicator Lamp (MIL) On

Customer Complaint/Technician Observation: Owner complaint, cluster warning lamps are on and the throttle input and vehicle speed limited, “limp mode”. Technician observed PCM Diagnostic Trouble Codes (DTC’s) **P2122 Accelerator Pedal Position Sensor 1 Circuit Low, P0335 Crankshaft Position Sensor Circuit, Sensor Reference Voltage 1 Circuit Low, U0402 Implausible Data Received from Transmission Control Module (TCM).**

Repair Procedure: Inspect the harness at the area as shown; review for chaffing, stretching, or pinching at the harness retainer. If harness damage is present, repair and isolate the harness following the standard circuit repair process. View **DealerCONNECT/Service Library, Non-DTC Diagnostics/Circuit Testing Procedures/Standard Procedure/Wire Splicing.**

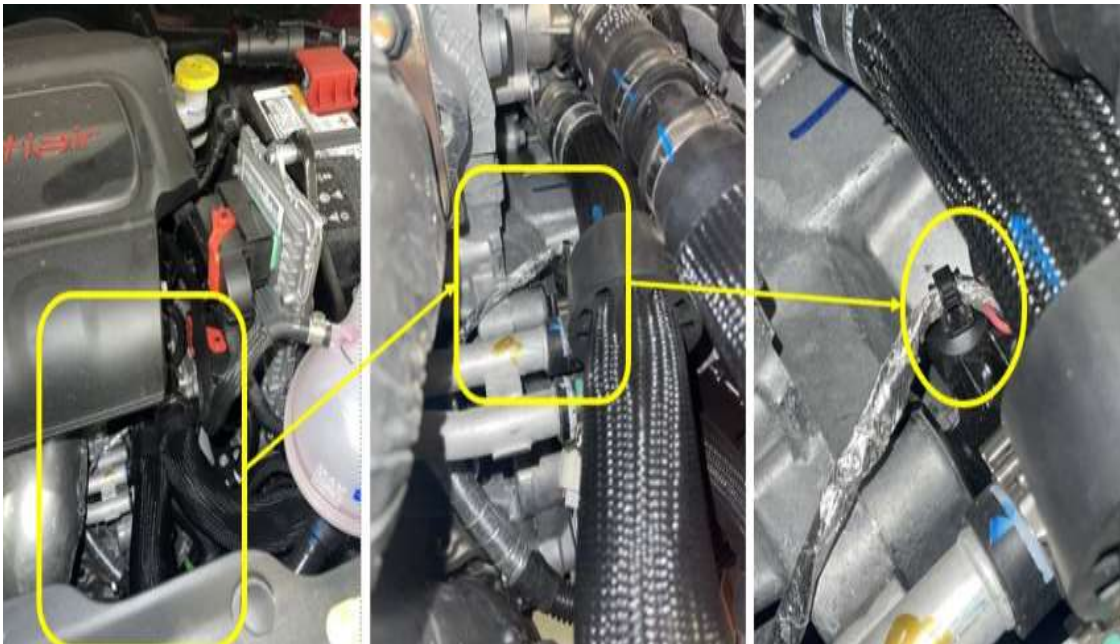

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found