



Technical Service Bulletin

15 4.0 TFSI: DTC P11DE00 incorrect cylinder allocation

15 22 42 2068072/1 September 22, 2022.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8	2019 – 2021	All	4.0 Engine – CXYA
S8	2019 -2021		4.0 Engine – CWWB
RS Q8	2020 – 2021		4.0 Engine – DHUB

Condition

Customer statement:

- MIL on.

Workshop findings:

The following DTCs and symptom code combinations are stored in the Engine Control Module, -J623- (address word 0001):

- DTC P11DE00 (Cam Shift Actuator Outlet "B" Cylinder 6 Range/Performance).

Technical Background

There is a diagnostic error in the software which identifies the incorrect cylinder during diagnosis.

Production Solution



Technical Service Bulletin

New software implemented in production from MY 2022.

Service

- **DTC P11DE00** incorrectly identifies cylinder 6. All diagnostic work should be carried out on cylinder 3.

Warranty

This TSB is informational only and not applicable to any Audi warranty.

Additional Information

All parts and service references provided in this TSB (**2068072**) are subject to change and/or removal.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.