
**SSM 51111 2020-2022 F53 Motorhome And 2021-2022 E-Series -
Service AdvanceTrac Message With DTC C0051 And Inoperative
Cruise Control - Built On Or Before 06-Oct-2022**

Some 2020-2022 F53 Motorhome built on or before 06-Oct-2022 and 2021-2022 E-Series vehicles built on or before 09-Mar-2021 may exhibit a Service AdvanceTrac and Pre-Collision Assist Not Available message in the cluster with diagnostic trouble code (DTC) C0051 stored in the anti-lock brake system (ABS) module. Cruise control may also be inoperative. To correct the condition, reprogram the ABS module using the latest software level of the Integrated Diagnostic System (IDS). For claiming, use causal part number 2C219 and applicable labor times in Section 10 of the Service Labor Time Standards (SLTS) Manual.