



Mack Chassis - Malfunction Indicator Light (MIL) Illuminated After Start Up - Cummins CNG Only



> Internal Content

Some Mack chassis trucks with a Cummins CNG engine may exhibit a Malfunction Indicator Light (MIL) (with no code) illuminated after approx. 20 seconds of run time.

It has been determined that the root cause of the MIL is a direct result of a software change. US17-OB18 trucks built with Cummins CNG engine, Dual position steering wheel (Both Sides), and extend short cab length could be affected. New software has been introduced to remedy this complaint. See chart below.

Module	Software P/N
MID 140	24413195
MID 234 (If Applicable)	24413238

Tags [mil](#) [no codes](#) [mack](#)

Related links and attachments

No links or attachments available



[Give feedback](#)

to help improve the content of this article

