

Vibrations From Steering After Changing To Winter Or All-Season Tires

Topic number	LI46.35-P-075129
Version	1
Function group	46.35 - Electrical steering
Date	8/2/22
Validity	177.051/053/054 177.151 177.951 118.351/353/354 118.651/653/654 247.651 247.751/753/754
Reason for change	Change made to description of problem and cause, new deadline for remedy software

Complaint

Vibrations in steering at speeds lower than 30 mph. Possible when turning and also partly noticeable after changing to winter or all-season tires.

Cause

Controller stability of steering software, caused by reduced friction in steering (tolerance for production + running-in characteristics).

Remedy

Software update available in 1st quarter of 2023 (adaptation of stability limits)

Symptoms
Chassis/suspension > Steering system > Steering wheel > Vibrates

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note